

## **Port of Hay Point**

# **Ambient Air, Noise and Weather Monitoring**

Validated Report

1<sup>st</sup> November – 30<sup>th</sup> November 2021

Report No.: DAT17760 Revision 1

Report issue date: 10<sup>th</sup> January 2022

Maintenance contract: MC2099

ECOTECH PTY LTD. ABN: 32005752081

1492 Ferntree Gully Rd, Knoxfield VIC. 3180. AUSTRALIA

Tel No: 1300 364 946 Fax No: 1300 668 763

Email ecotech@ecotech.com WEB www.ecotech.com

This document shall not be reproduced except for in full, without the written approval of Ecotech Pty Ltd.

### Report No: DAT17760 Revision 1

Customer Details		
Customer Dalrymple Bay Coal Terminal (DBCT) Pty Ltd		
Contact name Environmental Services Team		
Address Martin Armstrong Drive, Hay Point, QLD 4740		
Email EnvironmentalServicesTeam@dbct.com.au		
Phone	(07) 4943 8444	

Revision History						
Revision Report ID Date Analyst						
0	DAT17760	20/12/2021	Robyn Edwards			
1	DAT17760	10/01/2022	Robyn Edwards			

<sup>\*</sup>Refer to Appendix 2 – Amendments for details of changes

Report by:	Robyn Edwards	Androycle
Approved Signatory:	Jon Alexander	- m

### Report No: DAT17760 Revision 1

#### **Port of Hay Point**

#### **Table of Contents**

Customer Details.		2
Revision History		2
Table of Contents	j	3
List of Figures		4
List of Tables		5
1.0 Introduction.		6
1.1. Purpose of	f monitoring	6
2.0 Monitoring a	and Data Collection	7
2.1. Siting Deta	ails	7
2.2. Monitored	d Parameters	10
2.3. Data Collec	ection Methods	12
2.3.1. Data A	Acquisition	13
2.3.2. Sampl	oling and analysis for Rain	13
2.3.3. Sampl	oling and analysis for Noise	13
2.3.4. Sampl	oling and analysis for Deposited Dust	13
2.4. Data Valida	lation and Reporting	13
2.4.1. Valida	ation	13
2.4.2. Repor	rting	14
3.0 Air Quality Ob	bjectives	16
4.0 Results		17
4.1. Data Captu	ure	17
4.2. Complaints	`S	18

### Report No: DAT17760 Revision 1

4.3.	Air Quality Summary	18
4.3	.1. Air Quality Index (AQI) Rating Assessment	18
4.4.	Graphic Representations	20
Appendi	x 1 - Definitions & Abbreviations	36
Appendi	x 2 - Amendments	37
List of	Figures	
Figure 1:	Port of Hay Point Residential, Rain Gauge and Control Monitoring Stations Location	8
Figure 2:	Detail of the Port of Hay Point Residential Stations Location and Rain Gauge	9
Figure 3:	Daily PM <sub>10</sub> Averages for the Port of Hay Point Assessed Against the Air Quality Index	19
-	Port of Hay Point PM <sub>10</sub> 24-Hour Average Data Compared to the Licence Limit for November	
Figure 5:	Dust Deposition Results for Northern Sites, November 2021	22
Figure 6:	Dust Deposition Results for Southern Sites, November 2021	23
Figure 7:	Noise Levels Recorded at P1 for November 2021	25
Figure 8:	Noise Levels Recorded at P2 for November 2021	26
Figure 9:	Noise Levels Recorded at P3 for November 2021	27
Figure 10	0: Noise Levels Recorded at P4 for November 2021	28
Figure 11	1: P1 Wind Rose 5-Minute Data for November 2021	29
Figure 12	2: P2 Wind Rose 5-Minute Data for November 2021	30
Figure 13	3: P3 Wind Rose 5-Minute Data for November 2021	31
Figure 14	4: P4 Wind Rose 5-Minute Data for November 2021	32
Figure 15	5: Port of Hay Point AT 5-Minute Averages Data for November 2021	33
Figure 16	6: Port of Hay Point RH 5-Minute Averages Data for November 2021	34

### Report No: DAT17760 Revision 1

Figure 17: Port of Hay Point Rain Daily Totals for November 2021	35
List of Tables	
Table 1: Port of Hay Point Residential and Control Monitoring Sites Locations	7
Table 2: Parameters measured at the Port of Hay Point Residential and Control Monitoring Stations	s 10
Table 3: Methods	12
Table 4: Port of Hay Point Air Quality Objectives	16
Table 5: P1-P4 Data Capture for November 2021	17
Table 6: Colour-coded Categories for Air Quality Index	18
Table 7: Port of Hay Point Wind Direction and PM $_{10}$ 24h Average Data for November 2021	21
Table 8: Noise Levels (L <sub>A90</sub> ) Measured at P1, P2, P3 and P4 for November 2021	24

**Report No: DAT17760 Revision 1** 

**Port of Hay Point** 

#### 1.0 Introduction

Ecotech Pty Ltd was commissioned by North Queensland Bulk Ports Corporation (NQBP), Dalrymple Bay Coal Terminal Pty Ltd (DBCT P/L) and BMA Hay Point Coal Terminal (HPCT) to provide monitoring and data reporting for the Port of Hay Point environmental monitoring program in Hay Point, Queensland. Ecotech commenced services under the ambient air quality monitoring program Contract SA294.2016 on the 1<sup>st</sup> of March 2017.

This report presents the data for November 2021.

The data presented in this report:

- Describes air quality measurements;
- Compares monitoring results;
- Has been quality assured.

#### 1.1. Purpose of monitoring

This Ambient Air Monitoring Program has been established to proactively monitor ambient air, noise and meteorological conditions in the community surrounding the Port of Hay Point. The program consists of two control stations (C1 and C2), nine ambient air quality monitoring stations (P1, P2, P3, P4, S1, S2, S3, S5 and S6) and one rain gauge as described in Table 1.

Since the commencement of this monitoring program in 1993, Louisa Creek township has been identified as future strategic port land. NQBP have introduced a voluntary residential buy back scheme and taken steps to prevent residential re-intensification in zones immediately adjacent to the Port. Subsequently the monitoring station - P2 is no longer in as populated residential location as when the program initially began.

#### Report No: DAT17760 Revision 1

**Port of Hay Point** 

### 2.0 Monitoring and Data Collection

#### 2.1. Siting Details

The Sites consist of two Control stations (C1 and C2), nine Residential ambient air quality monitoring stations (P1, P2, P3, P4, S1, S2, S3, S5 and S6) and one Rain Gauge. The stations' location and siting details are described in the following table and figures.

Table 1: Port of Hay Point Residential and Control Monitoring Sites Locations

Site Name	Geographical Coordinates	Height Above Sea Level (m)
C1 - Grasstree Beach (South)	21°21'54.71"S, 149°18'25.60"E	8
C2 - Grasstree Beach (North)	21°22'3.06"S, 149°18'27.19"E	10
P1 - Louisa Creek, Edmund Avenue (North)	21°16'21.43"S, 149°15'47.96"E	6
P2 - Louisa Creek, Edmund Avenue (South)	21°16'48.46"S, 149°16'34.64"E	10
P3 - Half Tide Car Park	21°17'45.34"S, 149°17'21.76"E	9
P4 - Salonika Beach	21°18'29.32"S, 149°17'33.64"E	12
S1 - Louisa Creek (North)	21°16'35.88"S, 149°16'14.42"E	1
S2 - Louisa Creek (South)	21°16'46.88"S, 149°16'29.00"E	4
S3 – Osborne's Residence	21°17'23.20"S, 149°16'10.05"E	15
S5 - Salonika Beach	21°18'11.60"S, 149°17'35.24"E	13
S6 - Half Tide Beach	21°17'56.83"S, 149°17'31.84"E	9
Rain Gauge	21°17'23.52"S, 149°17'17.41"E	7

### Report No: DAT17760 Revision 1



Figure 1: Port of Hay Point Residential, Rain Gauge and Control Monitoring Stations Location

Report No: DAT17760 Revision 1



Figure 2: Detail of the Port of Hay Point Residential Stations Location and Rain Gauge

#### Report No: DAT17760 Revision 1

**Port of Hay Point** 

#### 2.2. Monitored Parameters

Table 2 details the parameters monitored and the instruments used at Port of Hay Point Residential and Control monitoring stations. Appendix 1 defines any abbreviated parameter names used throughout the report.

Sampling of all parameters is continuous, with the exception of Deposited dust. Deposited dust is captured over a one-month period and the sample bottles collected once a month.

For meteorological sensors, the elevation given in the table below is the height above ground level at the monitoring station.

Table 2: Parameters measured at the Port of Hay Point Residential and Control Monitoring Stations

Site Code	Parameter Measured	Instrument and Measurement Technique	
C1, C2, S1, S2, S3, S5 and S6	Deposited Particulate Matter	Dust Deposition Gauge	
	Deposited Particulate Matter	Dust Deposition Gauge	
	PM <sub>10</sub>	Thermo – TEOM 1405 (Tapered Element Oscillating Microbalance)	
Р3	Wind Speed (horizontal, elevation 10m)	Vaisala WXT520 Multi-sensor Weather Monitor	
	Wind Direction (elevation 10m)	Vaisala WXT520 Multi-sensor Weather Monitor	
	Ambient Temperature (elevation 10m)	Vaisala WXT520 Multi-sensor Weather Monitor	
	Relative Humidity (elevation 10m)	Vaisala WXT520 Multi-sensor Weather Monitor	
Noise		Class 1 Brüel & Kjær 2250 Sound Level Meter	
P1, P2 and P4	Deposited Particulate Matter	Dust Deposition Gauge	

### Report No: DAT17760 Revision 1

**Port of Hay Point** 

Site Code	Parameter Measured	Instrument and Measurement Technique
	PM <sub>10</sub>	Thermo – TEOM 1405 (Tapered Element Oscillating Microbalance)
	Wind Speed (horizontal, elevation 10m)	Gill Windsonic Op1
	Wind Direction (elevation 10m)	Gill Windsonic Op1
	Noise	Class 1 Brüel & Kjær 2250 Sound Level Meter
Rain Gauge	Rainfall	Hydrological Services tipping bucket rain gauge - Model TB3

Since the beginning of the project in March 2017 until the  $9^{th}$  of July 2018, the TEOMs at sites P1, P2, P3 and P4 were configured to measure TSP. After this date, measurements were changed to PM<sub>10</sub> due to updates to the Dalrymple Bay Coal Terminal Pty Ltd and Hay Point Environmental Authority Permit<sup>1</sup>.

<sup>&</sup>lt;sup>1</sup> Department of Environment and Heritage Protection Environmental Authority Permits EPPR00474413 and EPPR00504513.

### Report No: DAT17760 Revision 1

**Port of Hay Point** 

#### 2.3. Data Collection Methods

Table 3 below shows the methods used for data collection.

**Table 3: Methods** 

Parameter Measured Data Collection  Methods Used		Description of Method		
Deposited Particulate Matter (Sampling by Ecotech)	AS/NZS 3580.10.1 2016	Methods for sampling and analysis of ambient air. Method 10.1: Determination of particulate matter—Deposited matter—Gravimetric method		
Deposited Particulate Matter (Analysis by SGS)	AN502(Sydney) /AN503	The mass deposition rate of deposited matter is calculated from the mass of solids obtained, the funnel cross-section area and the exposure period.		
PM <sub>10</sub> (TEOM)	AS/NZ 3580.9.8-2008	Methods for sampling and analysis of ambient air. Method 9.8: Determination of suspended particulate matter - $PM_{10}$ continuous direct mass method using a tapered element oscillating microbalance analyser.		
Vector Wind Speed (Horizontal)	AS/NZS 3580.14 2014	Methods for sampling and analysis of ambient air. Method Meteorological monitoring for ambient air quality monitoring applications		
Vector Wind Direction	AS/NZS 3580.14 2014	Methods for sampling and analysis of ambient air. Method 14: Meteorological monitoring for ambient air quality monitoring applications		
II // MNIANT II		Methods for sampling and analysis of ambient air. Method 14: Meteorological monitoring for ambient air quality monitoring applications		
Relative Humidity	AS/NZS 3580.14 2014 Methods for sampling and analysis of ambient air quality applications			
Rain (Sampling by external contractor)	AS/NZS 3580.14 2014	Methods for sampling and analysis of ambient air. Method 14: Meteorological monitoring for ambient air quality monitoring applications. Rainfall by tipping bucket rain gauge		
Noise (L <sub>eq</sub> , L <sub>10</sub> and L <sub>90</sub> ) (Analysis by Marshall Day Acoustics)	by Marshall Manual (2013) and AS noise - Part 1: General procedu			

#### Report No: DAT17760 Revision 1

**Port of Hay Point** 

#### 2.3.1. Data Acquisition

Data acquisition for continuously monitored parameters, with the exception of noise and rain, is performed using an Envista logger situated at each of the monitoring sites. Each logger is equipped with a 4G modem for remote data collection. The recorded data is remotely collected and transferred via FTP at 10-minute intervals (using Airodis<sup>TM</sup> version 5.1.6) and stored at Ecotech's Environmental Reporting Services (ERS) department in Melbourne, Australia. Data samples are logged in 5-minute intervals.

#### 2.3.2. Sampling and analysis for Rain

Rain sampling and analysis are conducted by an external contractor. The 5-minute data is sent monthly to Ecotech by Dalrymple Bay Coal Terminal Pty Ltd (DBCT P/L).

#### 2.3.3. Sampling and analysis for Noise

Noise data samples are logged in 5-minute intervals. The data is downloaded monthly by Ecotech field service technicians and sent to Marshall Day Acoustics for analysis.

#### 2.3.4. Sampling and analysis for Deposited Dust

Deposited dust sampling is conducted by Ecotech field service technicians. Sample bottles are sent to SGS Cairns Environmental Laboratory for analysis. The laboratory is NATA accredited for compliance with ISO/IEC 17025:2005 (Acc. No. 2562, Site No.3146).

#### 2.4. Data Validation and Reporting

#### 2.4.1. Validation

The Ecotech ERS department perform daily data checks on continuously monitored parameters (with the exception of noise and rainfall data) to ensure maximum data capture rates are maintained. Any equipment failures are communicated to the responsible field engineers for urgent rectification. Ecotech ERS maintains two distinct databases containing non-validated and validated data respectively.

The validated database is created by duplicating the non-validated database and then flagging data affected by instrument faults, calibrations and other maintenance activities. The data validation software requires the analyst to supply a valid reason (e.g., backed by maintenance notes, calibration sheets etc.) in the database for flagging any data as invalid.

Details of all invalid or missing data are recorded in the Valid Data Exception Tables.

#### Report No: DAT17760 Revision 1

**Port of Hay Point** 

Validation is performed by the analyst, and the validation is reviewed. Graphs and tables are generated based on the validated five-minute data.

Note: Validation for noise data is performed by the subcontractor Marshall Day Acoustics.

#### 2.4.2. Reporting

The data contained in this report is based on Australian Eastern Standard Time.

All averages are calculated from the five-minute data. Averages are based on a minimum of 75% valid readings within the averaging period. Where data capture is low for a particular parameter, summary values (e.g., monthly maximum and minimum) may be based on less than 75% valid samples.

The reader should use caution when interpreting these values as they may not be representative of conditions for the entire sample period.

Averaging periods of eight hours or less are reported for the end of the period, i.e., the hourly average 02:00am is for the data collected from 1:00am to 2:00am. One-hour averages are calculated based on a clock hour. One day averages are calculated based on calendar days.

#### **Rain Reporting**

Rain results are provided to Ecotech by Dalrymple Bay Coal Terminal Pty Ltd (DBCT P/L) and included in this report.

#### Report No: DAT17760 Revision 1

**Port of Hay Point** 

#### **Deposited Dust Reporting**

Deposited dust results are provided to Ecotech by the SGS Cairns Environmental Laboratory and summarised within this report.

#### **Noise Data Reporting**

Noise levels results are provided to Ecotech by Marshall Day Acoustics and summarised within this report.

#### **Wind Data Reporting**

Wind speed and wind direction data associated with calm wind conditions are reported in accordance with the requirements of *AS/NZS 3580.14-2014*. Calm wind conditions are defined as wind speeds below the starting threshold of the wind speed/direction sensors.

Report No: DAT17760 Revision 1

**Port of Hay Point** 

### 3.0 Air Quality Objectives

The air quality objectives monitored at the Port of Hay Point monitoring network sites are taken from the Dalrymple Bay Coal Terminal Pty Ltd and Hay Point Environmental Authority Permit<sup>2</sup>.

The air quality objectives are shown in Table 4 below.

**Table 4: Port of Hay Point Air Quality Objectives** 

Parameter	Time Period	Licence Limit	Units
Deposited Dust – Total Insoluble Solids	1 day: based on 1 month sampling	120 mg/m²/day	mg/m²/day
PM <sub>10</sub>	1 day	50 μg/m³ – when generated by port activities and measured at any sensitive or commercial place	μg/m³
L <sub>A90</sub>	15 min	Day level (7am – 7pm) = 55 dB(A) Night level (7pm – 7am) = 53 dB(A)	dB(A)

<sup>&</sup>lt;sup>2</sup> Department of Environment and Heritage Protection Environmental Authority Permits EPPR00474413 and EPPR00504513.

#### Report No: DAT17760 Revision 1

**Port of Hay Point** 

#### 4.0 Results

#### 4.1. Data Capture

Data capture is based on 5-minute data and refers to the amount of available data collected during the report period. The percentage of data captured is calculated using the following equation:

Data capture = (Reported air quality data / Total data) x 100%

#### Where:

- Reported air quality data = Number of instrument readings which have been validated through
  a quality assured process and excludes all data errors, zero data collection due to calibration,
  failures and planned and unplanned maintenance.
- Total data = Total number of instrument readings since the start of the term assuming no maintenance, errors, loss of data or calibration.

Table 5 displays data capture statistics for the reporting period (November 2021). **Bold** values in the table indicate data capture below 90%.

**Table 5: P1-P4 Data Capture for November 2021** 

	Data Capture (%)			
Parameter	P1	P2	Р3	P4
PM <sub>10</sub>	97.8	97.7	97.9	97.5
WS and WD	97.4	98.4	99.3	99.3
AT <sup>3</sup>			99.3	
RH			99.4	
Noise	100.0	99.9	99.9	99.9

The data capture for all of the parameters at sites P1, P2, P3 and P4 was above 90% for the reporting month.

<sup>&</sup>lt;sup>3</sup> AT and RH parameters are only measured at P3 station.

#### Report No: DAT17760 Revision 1

**Port of Hay Point** 

The overall monthly percentage of data captured for the 11 Dust Deposition Gauges was 100%.

#### 4.2. Complaints

There were no external contacts regarding dust received by the PoHP terminals during November 2021.

#### 4.3. Air Quality Summary

#### 4.3.1. Air Quality Index (AQI) Rating Assessment

The index value is the pollutant concentration expressed as a proportion of the pollutant goal concentration: dividing the pollutant concentration by the pollutant goal concentration and then multiplying by 100. For Queensland, the 'pollutant goal concentration' used to calculate the index value is defined by the Air National Environment Protection Measure for Ambient Air Quality (Air NEPM) standard and it is equal to  $50\,\mu\text{g/m}^3$  for PM<sub>10</sub>. The air quality index comprises five colour-coded categories shown on the next table. <sup>4</sup>

**Table 6: Colour-coded Categories for Air Quality Index** 

Not	Very good	Good	Fair	Poor	Very poor
available	0-33	34-66	67-99	100-149	>150

The  $PM_{10}$  24-hour average values for the reporting month in the stations P1, P2, P3 and P4 were assessed against the Air Quality Index (AQI) Rating, and the pie chart on the next page presents the percentage of the days for which a specific air quality index category was identified.

<sup>4</sup> https://www.qld.gov.au/environment/pollution/monitoring/air-monitoring/air-quality-index/

#### Report No: DAT17760 Revision 1

**Port of Hay Point** 

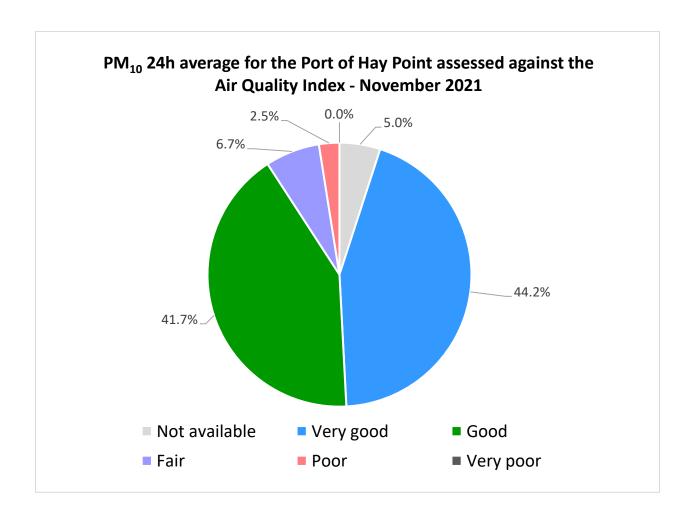


Figure 3: Daily PM<sub>10</sub> Averages for the Port of Hay Point Assessed Against the Air Quality Index

The majority of the days during the reporting period (November 2021) presented Air Quality Index classified as Very good (44.2%) or Good (41.7%).

#### **Report No: DAT17760 Revision 1**

**Port of Hay Point** 

#### 4.4. Graphic Representations

Validated 5-minute data for PM<sub>10</sub>, Wind speed, Wind direction, AT, RH, Rainfall and Noise were used to construct the following monthly graphic representations and summary tables.

For PM $_{10}$ , the licence limit is 50 µg/m $^3$  for the 24-hour average measured downwind of site. If the wind is from the South, sites P1 and P2 are downwind of site. If the wind is from the North, sites P3 and P4 are downwind of site. The following graph and table summarise the wind direction and PM $_{10}$  results for the month compared to the licence limit. Values highlighted in red in the table indicate a PM $_{10}$  exceedance. Values shaded in dark grey indicate wind direction from the North.

### Port of Hay Point PM<sub>10</sub> 24h average November 2021 PM<sub>10</sub> from P1 if WD from South PM<sub>10</sub> from P2 if WD from South PM₁₀ from P4 if WD from North PM<sub>10</sub> from P3 if WD from North 50 45 40 Gravimetric Concentration (µg/m³) 35 30 25 20 15 10 8 Mon 22 Mon 1 Wed Nov 2021

Figure 4: Port of Hay Point PM<sub>10</sub> 24-Hour Average Data Compared to the Licence Limit for November 2021

Report No: DAT17760 Revision 1

Table 7: Port of Hay Point Wind Direction and PM<sub>10</sub> 24h Average Data for November 2021

Date	PM <sub>10</sub> exceedence limit (μg/m³)	Wind direction	P1 PM <sub>10</sub> (μg/m³)	P2 PM <sub>10</sub> (μg/m³)	P3 PM <sub>10</sub> (μg/m³)	P4 PM <sub>10</sub> (μg/m³)
1/11/2021	50.0	South	31	34	39	59
2/11/2021	50.0	South	25	33	28	48
3/11/2021	50.0	South	23	28	28	51
4/11/2021	50.0	South	22	25	24	46
5/11/2021	50.0	South	17	19	16	38
6/11/2021	50.0	South	15	18	12	32
7/11/2021	50.0	North	15	20	15	23
8/11/2021	50.0	North	18	26	19	17
9/11/2021	50.0	North	17	23	18	16
10/11/2021	50.0	North	15	25	15	14
11/11/2021	50.0	North	18	30	20	18
12/11/2021	50.0	North	17	31	20	21
13/11/2021	50.0	South	9	16	15	15
14/11/2021	50.0	South	10	13	16	14
15/11/2021	50.0	South	13	15	14	13
16/11/2021	50.0	South	16	19	18	19
17/11/2021	50.0	South	18	21	21	34
18/11/2021	50.0	South	30	34	33	55
19/11/2021	50.0	South	21	25	24	41
20/11/2021	50.0	South	16	24	17	28
21/11/2021	50.0	North	14	15	16	15
22/11/2021	50.0	North	-	-	-	-
23/11/2021	50.0	South	-	-	13	33
24/11/2021	50.0	North	13	16	12	24
25/11/2021	50.0	North	11	15	13	15
26/11/2021	50.0	North	14	15	14	11
27/11/2021	50.0	North	13	15	14	13
28/11/2021	50.0	South	11	14	11	15
29/11/2021	50.0	South	14	18	18	26
30/11/2021	50.0	South	16	25	16	29

#### Report No: DAT17760 Revision 1

**Port of Hay Point** 

The next graphs present the deposited dust results for the Total Insoluble Solids in comparison with the licence limit for the reporting month<sup>5</sup>. The results are presented in two different graphs: one for the sites located to the North of the Terminal (S1, S2, S3, P1 and P2) and another for the sites located to the South of the Terminal (S5, S6, P3 and P4).

The Total Insoluble Solids are classified in 4 categories: organic matter (plant and animal material), fine dark particles (dark material), mineral fraction (light material) and other material such as plastics.

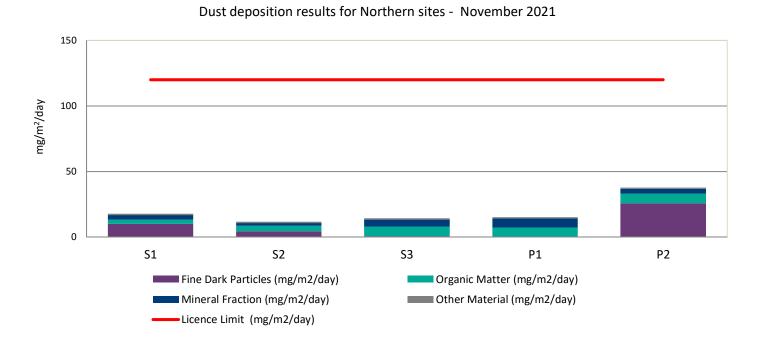


Figure 5: Dust Deposition Results for Northern Sites, November 2021

<sup>&</sup>lt;sup>5</sup> Results were provided to Ecotech by the SGS Cairns Environmental Laboratory.

#### Report No: DAT17760 Revision 1

**Port of Hay Point** 

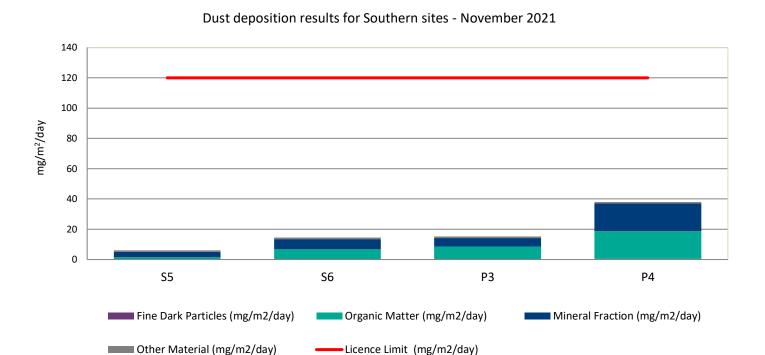


Figure 6: Dust Deposition Results for Southern Sites, November 2021

Total Insoluble Solids concentration for sites P1, P2, P3 and P4 was below the licence. During November 2021, the prevailing wind direction was from the South (60 % of the days).

#### Report No: DAT17760 Revision 1

**Port of Hay Point** 

Table 8 provides a summary of the average  $L_{A90}$  values recorded at sites P1, P2, P3 and P4 during September 2021. Result summaries and interpretations below are those provided by Marshall Day Acoustics.

Table 8: Noise Levels (L<sub>A90</sub>) Measured at P1, P2, P3 and P4 for November 2021

Location	L <sub>A90</sub> dB Average 12hr Level*	Standard deviation	Range	
P1 Day	42	4.0	34 - 58	
P1 Night	41	3.6	34 – 63	
P2 Day	49	3.5	40 – 58	
P2 Night	50	3.0	40 – 61	
P3 Day	48	2.4	44 – 62	
P3 Night	49	3.1	44 – 66	
P4 Day	47	3.5	41 – 59	
P4 Night	47	3.7	41 - 63	

<sup>\*</sup>Average of L<sub>A90</sub>, 15 min for the day and evening periods

**Note**: The recorded noise levels include extraneous noise and weather-related events, and are not pure component sound levels.

The average  $L_{A90}$  sound pressure levels at all monitoring locations (including adverse weather and other extraneous noise sources) were below the corresponding target noise levels or the Day and Night periods.

Sound levels measured throughout November 2021 at monitoring locations P1, P2, P3 and P4 have been plotted in Figures 7 to Figure 10 respectively.

Report No: DAT17760 Revision 1

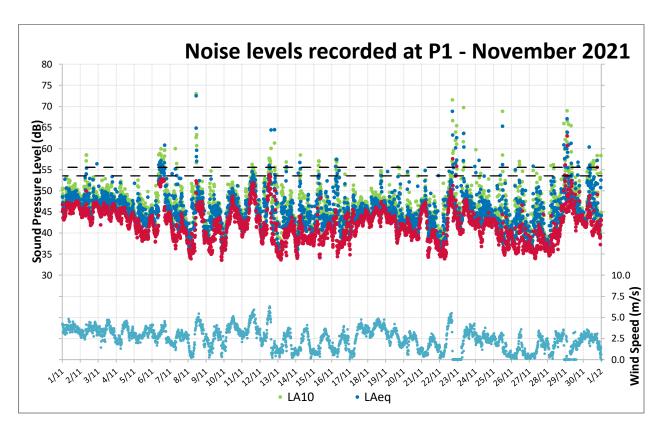


Figure 7: Noise Levels Recorded at P1 for November 2021

Report No: DAT17760 Revision 1

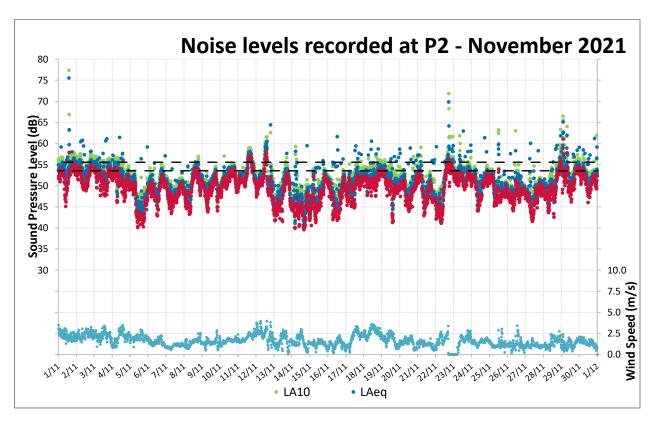


Figure 8: Noise Levels Recorded at P2 for November 2021

### Report No: DAT17760 Revision 1

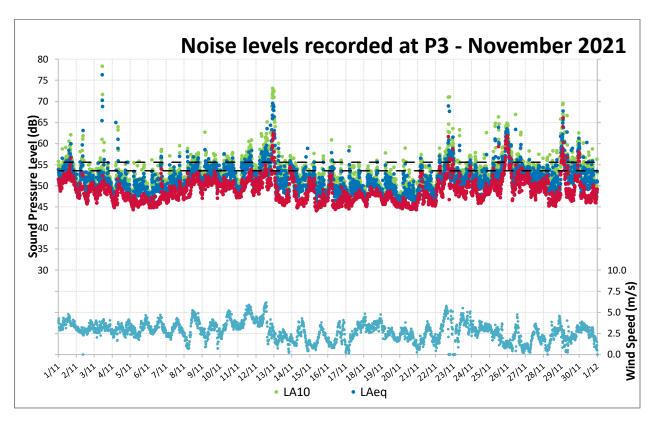


Figure 9: Noise Levels Recorded at P3 for November 2021

### Report No: DAT17760 Revision 1


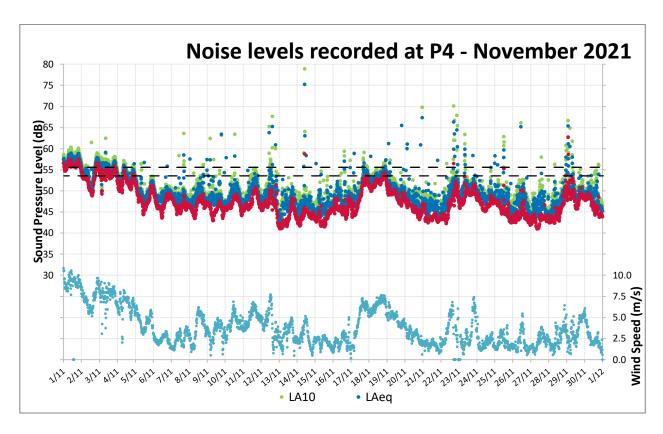


Figure 10: Noise Levels Recorded at P4 for November 2021

### Report No: DAT17760 Revision 1

**Port of Hay Point** 



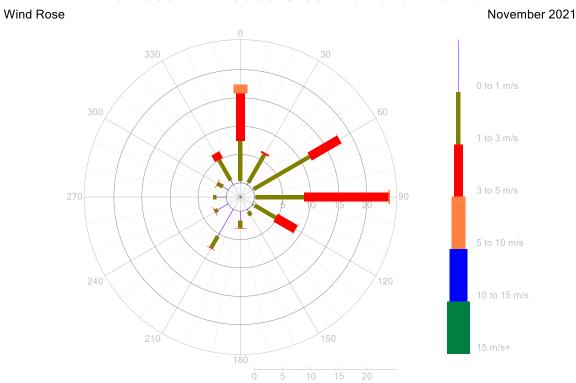


97.4% valid data present

Figure 11: P1 Wind Rose 5-Minute Data for November 2021

### Report No: DAT17760 Revision 1

**Port of Hay Point** 



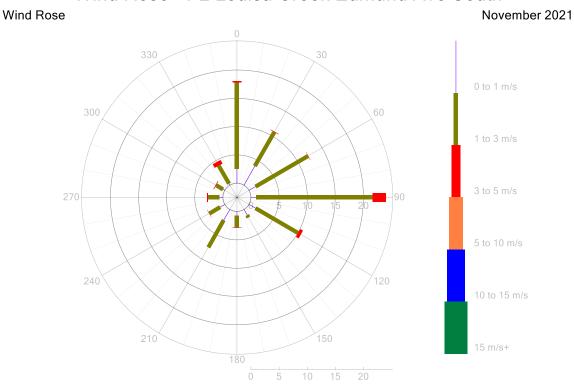

98.4% valid data present

Figure 12: P2 Wind Rose 5-Minute Data for November 2021

### Report No: DAT17760 Revision 1

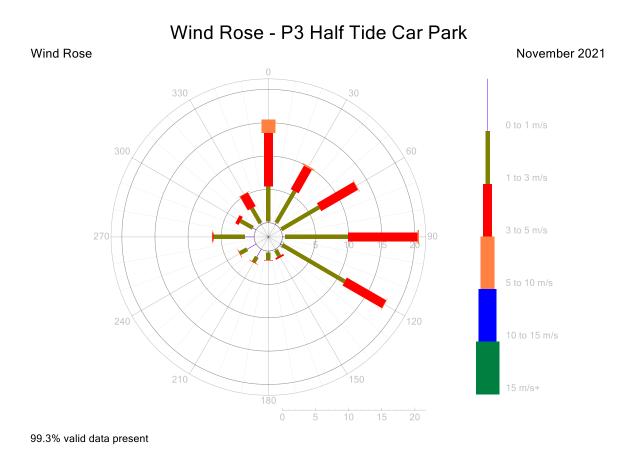


Figure 13: P3 Wind Rose 5-Minute Data for November 2021

### Report No: DAT17760 Revision 1

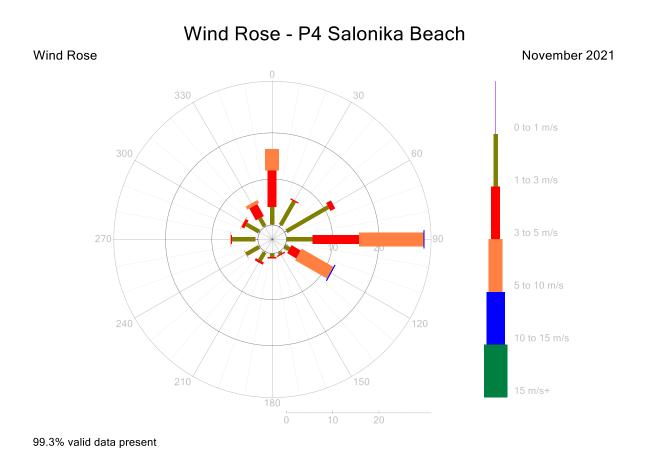


Figure 14: P4 Wind Rose 5-Minute Data for November 2021

#### Report No: DAT17760 Revision 1

**Port of Hay Point** 

# Ambient Temperature 5-Minute Averages - P3 Half Tide Car Park November 2021

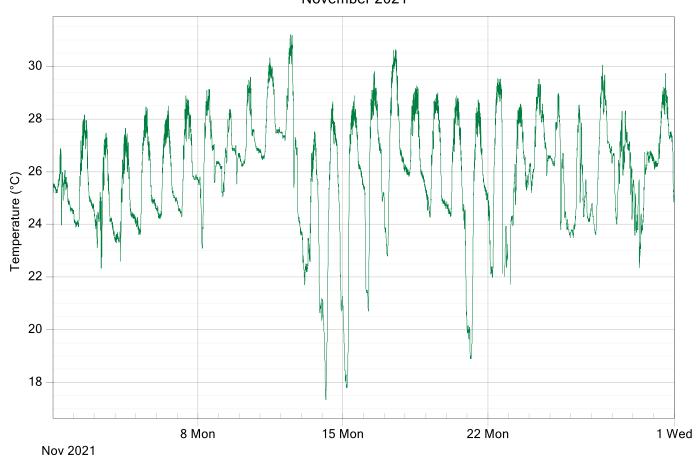


Figure 15: Port of Hay Point AT 5-Minute Averages Data for November 2021

### Report No: DAT17760 Revision 1

**Port of Hay Point** 

# Relative Humidity 5-Minute Averages - P3 Half Tide Car Park November 2021

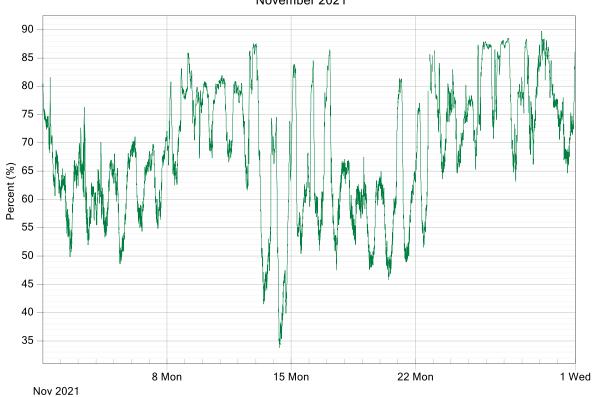


Figure 16: Port of Hay Point RH 5-Minute Averages Data for November 2021

### Report No: DAT17760 Revision 1

**Port of Hay Point** 

### Rain - Daily Totals

November 2021 90 80 70 60 Rainfall (mm) 50 40 30 20 10 0 8 Mon 15 Mon 22 Mon 1 Wed Nov 2021

Figure 17: Port of Hay Point Rain Daily Totals for November 2021

------ END OF REPORT ------

### Report No: DAT17760 Revision 1

**Port of Hay Point** 

### **Appendix 1 - Definitions & Abbreviations**

°C Degrees Celsius

μg/m³ Micrograms per cubic meter at standard temperature and pressure (0°C and 101.3

kPa)

AT Ambient Temperature

atm Atmosphere

calm Wind conditions where the wind speed is below the operating range of the wind

sensor

dBa A-weighted decibels

deg Degrees (True North)

m/s Meters per second

mg/m<sup>2</sup> Milligrams per square meter

PM<sub>10</sub> Particulate less than 10 microns in equivalent aerodynamic diameter

RH Relative Humidity

TSP Total suspended particulates

WD Vector Wind Direction

WS Vector Wind Speed

Report No: DAT17760 Revision 1

**Port of Hay Point** 

### **Appendix 2 - Amendments**

This amended report supersedes previously issued version of the report. Refer to the revision history on page 2 for details of previous revisions. The following modifications have been made in this revision:

- Deleted the Raw Weather Data worksheet from the accompanying excel report
- Added the Raw Noise Data worksheet to the accompanying excel report
- Updated Table of Contents