

# **Port of Hay Point**

# **Ambient Air, Noise and Weather Monitoring**

Validated Report

1st March – 31st March 2022

Report No.: DAT18172 Revision 1

Report issue date: 4<sup>th</sup> May 2022

Maintenance contract: MC2099

ECOTECH PTY LTD. ABN: 32005752081

1492 Ferntree Gully Rd, Knoxfield VIC. 3180. AUSTRALIA

Tel No: 1300 364 946 Fax No: 1300 668 763

Email ecotech@ecotech.com WEB www.ecotech.com

This document shall not be reproduced except for in full, without the written approval of Ecotech Pty Ltd.

Report No: DAT18172 Revision 1

**Port of Hay Point** 

Customer Details		
Customer	Dalrymple Bay Coal Terminal (DBCT) Pty Ltd	
Contact name Environmental Services Team		
Address	Martin Armstrong Drive, Hay Point, QLD 4740	
Email	EnvironmentalServicesTeam@dbct.com.au	
Phone	(07) 4943 8444	

Revision History					
Revision Report ID Date Analyst					
0	DAT18172	29/04/2022	Robyn Edwards		
1*	DAT18172	02/05/2022	Robyn Edwards		

<sup>\*</sup>Refer to Appendix 2 – Amendments for changes to the report

Report by:	Robyn Edwards	REdwyds

Approved Signatory: Jon Alexander

# Report No: DAT18172 Revision 1

# **Port of Hay Point**

#### **Table of Contents**

Cus	tomer	Details 2
Rev	ision H	listory2
Tab	le of Co	ontents 3
List	of Figu	ıres4
List	of Tab	les5
1.0	Introd	duction6
1.1.	. Pur	pose of monitoring6
2.0	Monit	toring and Data Collection7
2.1.	. Siti	ng Details7
2.2.	. Mo	onitored Parameters
2.3.	. Dat	ta Collection Methods12
2	2.3.1.	Data Acquisition
2	2.3.2.	Sampling and analysis for Rain
2	2.3.3.	Sampling and analysis for Noise
2	2.3.4.	Sampling and analysis for Deposited Dust
2.4.	. Dat	ta Validation and Reporting14
2	2.4.1.	Validation
2	2.4.2.	Reporting
3.0	Air Qı	uality Objectives
4.0	Resul	ts
4.1.	. Dat	ta Capture
4.2.	. Cor	mplaints 18

# Report No: DAT18172 Revision 1

4.3.	Air Quality Summary
4.3	.1. Air Quality Categories18
4.4.	Graphic Representations
Appendi	x 1 - Definitions & Abbreviations36
Appendi	x 2 – Amendments
List of	Figures
Figure 1:	Port of Hay Point Residential, Rain Gauge and Control Monitoring Stations Location8
Figure 2:	Detail of the Port of Hay Point Residential Stations Location and Rain Gauge9
Figure 3:	: Hourly PM $_{ m 10}$ Averages for the Port of Hay Point Assessed Against the Air Quality Index19
Figure 4:	: Port of Hay Point $PM_{10}$ 24-Hour Average Data Compared to the Licence Limit for March 2022 20
Figure 5	Dust Deposition Results for Northern Sites, March 2022
Figure 6:	Dust Deposition Results for Southern Sites, March 2022
Figure 7:	: Noise Levels Recorded at P1 for March 202225
Figure 8:	: Noise Levels Recorded at P2 for March 202226
Figure 9:	: Noise Levels Recorded at P3 for March 202227
Figure 10	0: Noise Levels Recorded at P4 for March 202228
Figure 1	1: P1 Wind Rose 5-Minute Data for March 202229
Figure 1	2: P2 Wind Rose 5-Minute Data for March 202230
Figure 1	3: P3 Wind Rose 5-Minute Data for March 202231
Figure 1	4: P4 Wind Rose 5-Minute Data for March 202232
Figure 1	5: Port of Hay Point AT 5-Minute Averages Data for March 202233
Figure 10	6: Port of Hay Point RH 5-Minute Averages Data for March 202234

# Report No: DAT18172 Revision 1

Figure 17: Port of Hay Point Rain Daily Totals for March 2022
List of Tables
Table 1: Port of Hay Point Residential and Control Monitoring Sites Locations
Table 2: Parameters measured at the Port of Hay Point Residential and Control Monitoring Stations 10
Table 3: Methods
Table 4: Port of Hay Point Air Quality Objectives
Table 5: P1-P4 Data Capture for March 2022
Table 6: Colour-coded Categories for Air Quality Categories
Table 7: Port of Hay Point Wind Direction and PM <sub>10</sub> 24h Average Data for March 202221
Table 8: Noise Levels (L <sub>A90</sub> ) Measured at P1, P2, P3 and P4 for March 202224

**Report No: DAT18172 Revision 1** 

**Port of Hay Point** 

#### 1.0 Introduction

Ecotech Pty Ltd was commissioned by North Queensland Bulk Ports Corporation (NQBP), Dalrymple Bay Coal Terminal Pty Ltd (DBCT P/L) and BMA Hay Point Coal Terminal (HPCT) to provide monitoring and data reporting for the Port of Hay Point environmental monitoring program in Hay Point, Queensland. Ecotech commenced services under the ambient air quality monitoring program Contract SA294.2016 on the 1<sup>st</sup> of March 2017.

This report presents the data for March 2022.

The data presented in this report:

- Describes air quality measurements;
- Compares monitoring results;
- Has been quality assured.

## **1.1.** Purpose of monitoring

This Ambient Air Monitoring Program has been established to proactively monitor ambient air, noise and meteorological conditions in the community surrounding the Port of Hay Point. The program consists of two control stations (C1 and C2), nine ambient air quality monitoring stations (P1, P2, P3, P4, S1, S2, S3, S5 and S6) and one rain gauge as described in Table 1.

Since the commencement of this monitoring program in 1993, Louisa Creek township has been identified as future strategic port land. NQBP have introduced a voluntary residential buy back scheme and taken steps to prevent residential re-intensification in zones immediately adjacent to the Port. Subsequently the monitoring station - P2 is no longer in as populated residential location as when the program initially began.

Report No: DAT18172 Revision 1

**Port of Hay Point** 

## 2.0 Monitoring and Data Collection

#### **2.1.** Siting Details

The Sites consist of two Control stations (C1 and C2), nine Residential ambient air quality monitoring stations (P1, P2, P3, P4, S1, S2, S3, S5 and S6) and one Rain Gauge. The stations' location and siting details are described in the following table and figures.

**Table 1: Port of Hay Point Residential and Control Monitoring Sites Locations** 

Site Name	Geographical Coordinates	Height Above Sea Level (m)
C1 - Grasstree Beach (South)	21°21'54.71"S, 149°18'25.60"E	8
C2 - Grasstree Beach (North)	21°22'3.06"S, 149°18'27.19"E	10
P1 - Louisa Creek, Edmund Avenue (North)	21°16'21.43"S, 149°15'47.96"E	6
P2 - Louisa Creek, Edmund Avenue (South)	21°16'48.46"S, 149°16'34.64"E	10
P3 - Half Tide Car Park	21°17'45.34"S, 149°17'21.76"E	9
P4 - Salonika Beach	21°18'29.32"S, 149°17'33.64"E	12
S1 - Louisa Creek (North)	21°16'35.88"S, 149°16'14.42"E	1
S2 - Louisa Creek (South)	21°16'46.88"S, 149°16'29.00"E	4
S3 – Osborne's Residence	21°17'23.20"S, 149°16'10.05"E	15
S5 - Salonika Beach	21°18'11.60"S, 149°17'35.24"E	13
S6 - Half Tide Beach	21°17'56.83"S, 149°17'31.84"E	9
Rain Gauge	21°17'23.52"S, 149°17'17.41"E	7

Report No: DAT18172 Revision 1



Figure 1: Port of Hay Point Residential, Rain Gauge and Control Monitoring Stations Location

Report No: DAT18172 Revision 1



Figure 2: Detail of the Port of Hay Point Residential Stations Location and Rain Gauge

#### Report No: DAT18172 Revision 1

## **Port of Hay Point**

#### 2.2. Monitored Parameters

Table 2 details the parameters monitored and the instruments used at Port of Hay Point Residential and Control monitoring stations. Appendix 1 defines any abbreviated parameter names used throughout the report.

Sampling of all parameters is continuous, with the exception of Deposited dust. Deposited dust is captured over a one-month period and the sample bottles collected once a month.

For meteorological sensors, the elevation given in the table below is the height above ground level at the monitoring station.

Table 2: Parameters measured at the Port of Hay Point Residential and Control Monitoring Stations

Site Code	Parameter Measured	Instrument and Measurement Technique	
C1, C2, S1, S2, S3, S5 and S6	Deposited Particulate Matter	Dust Deposition Gauge	
	Deposited Particulate Matter	Dust Deposition Gauge	
	PM <sub>10</sub>	Thermo – TEOM 1405 (Tapered Element Oscillating Microbalance)	
P3	Wind Speed (Horizontal, elevation 10m)	Vaisala WXT520 Multi-sensor Weather Monitor	
	Wind Direction (Elevation 10m)	Vaisala WXT520 Multi-sensor Weather Monitor	
	Ambient Temperature (Elevation 10m)	Vaisala WXT520 Multi-sensor Weather Monitor	
	Relative Humidity (Elevation 10m)	Vaisala WXT520 Multi-sensor Weather Monitor	
	Noise	Class 1 Brüel & Kjær 2250 Sound Level Meter	
P1, P2 and P4	Deposited Particulate Matter	Dust Deposition Gauge	

## Report No: DAT18172 Revision 1

## **Port of Hay Point**

Site Code	Parameter Measured	Instrument and Measurement Technique		
	PM <sub>10</sub>	Thermo – TEOM 1405 (Tapered Element Oscillating Microbalance)		
	Wind Speed (horizontal, elevation 10m)	Gill Windsonic Op1		
	Wind Direction (elevation 10m)	Gill Windsonic Op1		
Noise		Class 1 Brüel & Kjær 2250 Sound Level Meter		
Rain Gauge	Rainfall	Hydrological Services tipping bucket rain gauge - Mc TB3		

Since the beginning of the project in March 2017 until the  $9^{th}$  of July 2018, the TEOMs at sites P1, P2, P3 and P4 were configured to measure TSP. After this date, measurements were changed to PM<sub>10</sub> due to updates to the Dalrymple Bay Coal Terminal Pty Ltd and Hay Point Environmental Authority Permit<sup>1</sup>.

<sup>1</sup> Department of Environment and Heritage Protection Environmental Authority Permits EPPR00474413 and EPPR00504513.

Report No: DAT18172 Revision 1

**Port of Hay Point** 

#### 2.3. Data Collection Methods

Table 3 below shows the methods used for data collection.

**Table 3: Methods** 

Parameter Measured	Data Collection Methods Used	Description of Method	
Deposited Particulate Matter (Sampling by Ecotech)	AS/NZS 3580.10.1 2016	Methods for sampling and analysis of ambient air. Method 10.1: Determination of particulate matter—Deposited matter—Gravimetric method	
Deposited Particulate Matter (Analysis by SGS)	AN502 (Sydney) /AN503	The mass deposition rate of deposited matter is calculated from the mass of solids obtained, the funnel cross-section area and the exposure period.	
PM <sub>10</sub> (TEOM)	AS/NZ 3580.9.8-2008	Methods for sampling and analysis of ambient air. Method 9.8: Determination of suspended particulate matter - PM <sub>10</sub> continuous direct mass method using a tapered element oscillating microbalance analyser.	
Vector Wind Speed (Horizontal) AS/NZS 3580.14 2014		Methods for sampling and analysis of ambient air. Method 14: Meteorological monitoring for ambient air quality monitoring applications	
Vector Wind Direction  AS/NZS 3580.14 2014		Methods for sampling and analysis of ambient air. Method 14: Meteorological monitoring for ambient air quality monitoring applications	
Ambient Temperature  AS/NZS 3580.14 2014		Methods for sampling and analysis of ambient air. Method 14: Meteorological monitoring for ambient air quality monitoring applications	
Relative Humidity AS/NZS 3580.14 2014		Methods for sampling and analysis of ambient air. Method 14: Meteorological monitoring for ambient air quality monitoring applications	
Rain (Sampling by external contractor)	AS/NZS 3580.14 2014	Methods for sampling and analysis of ambient air. Method 14: Meteorological monitoring for ambient air quality monitoring applications. Rainfall by tipping bucket rain gauge	
Noise (L <sub>eq</sub> , L <sub>10</sub> and L <sub>90</sub> ) (Analysis by Marshall Day Acoustics)  DEHP Noise Measurement Manual (2013) and AS 1055.1: 1997		Acoustics - Description and measurement of environmental noise - Part 1: General procedures	

**Report No: DAT18172 Revision 1** 

#### **Port of Hay Point**

#### 2.3.1. Data Acquisition

Data acquisition for continuously monitored parameters, with the exception of noise and rain, is performed using an Envista logger situated at each of the monitoring sites. Each logger is equipped with a 4G modem for remote data collection. The recorded data is remotely collected and transferred via FTP at 10-minute intervals (using Airodis<sup>TM</sup> version 5.1.6) and stored at Ecotech's Environmental Reporting Services (ERS) department in Melbourne, Australia. Data samples are logged in 5-minute intervals.

#### 2.3.2. Sampling and analysis for Rain

Rain sampling and analysis are conducted by an external contractor. The 5-minute data is sent monthly to Ecotech by Dalrymple Bay Coal Terminal Pty Ltd (DBCT P/L).

#### 2.3.3. Sampling and analysis for Noise

Noise data samples are logged in 5-minute intervals. The data is downloaded monthly by Ecotech field service technicians and sent to Marshall Day Acoustics for analysis.

#### 2.3.4. Sampling and analysis for Deposited Dust

Deposited dust sampling is conducted by Ecotech field service technicians. Sample bottles are sent to SGS Cairns Environmental Laboratory for analysis. The laboratory is NATA accredited for compliance with ISO/IEC 17025:2005 (Acc. No. 2562, Site No.3146).

**Report No: DAT18172 Revision 1** 

**Port of Hay Point** 

#### 2.4. Data Validation and Reporting

#### 2.4.1. Validation

The Ecotech ERS department perform daily data checks on continuously monitored parameters (with the exception of noise and rainfall data) to ensure maximum data capture rates are maintained. Any equipment failures are communicated to the responsible field engineers for urgent rectification. Ecotech ERS maintains two distinct databases containing non-validated and validated data respectively.

The validated database is created by duplicating the non-validated database and then flagging data affected by instrument faults, calibrations and other maintenance activities. The data validation software requires the analyst to supply a valid reason (e.g., backed by maintenance notes, calibration sheets etc.) in the database for flagging any data as invalid.

Details of all invalid or missing data are recorded in the Valid Data Exception Tables.

Validation is performed by the analyst, and the validation is reviewed. Graphs and tables are generated based on the validated five-minute data.

Note: Validation for noise data is performed by the subcontractor Marshall Day Acoustics.

#### 2.4.2. Reporting

The data contained in this report is based on Australian Eastern Standard Time.

All averages are calculated from the five-minute data. Averages are based on a minimum of 75% valid readings within the averaging period. Where data capture is low for a particular parameter, summary values (e.g., monthly maximum and minimum) may be based on less than 75% valid samples.

The reader should use caution when interpreting these values as they may not be representative of conditions for the entire sample period.

Averaging periods of eight hours or less are reported for the end of the period, i.e., the hourly average 02:00am is for the data collected from 1:00am to 2:00am. One-hour averages are calculated based on a clock hour. One day averages are calculated based on calendar days.

#### **Rain Reporting**

Rain results are provided to Ecotech by Dalrymple Bay Coal Terminal Pty Ltd (DBCT P/L) and included in this report.

Report No: DAT18172 Revision 1

## **Port of Hay Point**

#### **Deposited Dust Reporting**

Deposited dust results are provided to Ecotech by the SGS Cairns Environmental Laboratory and summarised within this report.

#### **Noise Data Reporting**

Noise levels results are provided to Ecotech by Marshall Day Acoustics and summarised within this report.

#### **Wind Data Reporting**

Wind speed and wind direction data associated with calm wind conditions are reported in accordance with the requirements of *AS/NZS 3580.14-2014*. Calm wind conditions are defined as wind speeds below the starting threshold of the wind speed/direction sensors.

In Table 7 on page 21, "South" describes the wind direction arc between the compass points of >60 degrees and <240 degrees. "North" describes wind direction arc between the compass points of >240 degrees and more <60 degrees.

Report No: DAT18172 Revision 1

**Port of Hay Point** 

## 3.0 Air Quality Objectives

The air quality objectives monitored at the Port of Hay Point monitoring network sites are taken from the Dalrymple Bay Coal Terminal Pty Ltd and Hay Point Environmental Authority Permit<sup>2</sup>.

The air quality objectives are shown in Table 4 below.

**Table 4: Port of Hay Point Air Quality Objectives** 

Parameter	Time Period	Licence Limit	Units
Deposited Dust – Total Insoluble Solids	1 day: based on 1 month sampling	120 mg/m²/day	mg/m²/day
PM <sub>10</sub>	1 day	50 μg/m³ – when generated by port activities and measured at any sensitive or commercial place	μg/m³
L <sub>A90</sub>	15 min	Day level (7am – 7pm) = 55 dB(A) Night level (7pm – 7am) = 53 dB(A)	dB(A)

<sup>&</sup>lt;sup>2</sup> Department of Environment and Heritage Protection Environmental Authority Permits EPPR00474413 and EPPR00504513.

#### Report No: DAT18172 Revision 1

#### **Port of Hay Point**

#### 4.0 Results

#### 4.1. Data Capture

Data capture is based on 5-minute data and refers to the amount of available data collected during the report period. The percentage of data captured is calculated using the following equation:

Data capture = (Reported air quality data / Total data) x 100%

#### Where:

- Reported air quality data = Number of instrument readings which have been validated through
  a quality assured process and excludes all data errors, zero data collection due to calibration,
  failures and planned and unplanned maintenance.
- Total data = Total number of instrument readings since the start of the term assuming no maintenance, errors, loss of data or calibration.

Table 5 displays data capture statistics for the reporting period (March 2022). **Bold** values in the table indicate data capture below 90%.

Table 5: P1-P4 Data Capture for March 2022

	Data Capture (%)			
Parameter	P1	P2	Р3	P4
PM <sub>10</sub>	99.2	99.4	99.2	93.5
WS and WD	100.0	100.0	100.0	100.0
AT <sup>3</sup>			100.0	
RH			100.0	
Noise	100.0	100.0	100.0	100.0

The data capture for all of the parameters at sites P1, P2, P3, P4 was above 90% for the reporting month.

<sup>&</sup>lt;sup>3</sup> AT and RH parameters are only measured at P3 station.

## Report No: DAT18172 Revision 1

#### **Port of Hay Point**

The overall monthly percentage of data captured for the 11 Dust Deposition Gauges was 100%.

#### 4.2. Complaints

There was one external contacts regarding dust received by the PoHP terminals during March 2022.

#### 4.3. Air Quality Summary

#### 4.3.1. Air Quality Categories

Air quality categories rather than an air quality index have been adopted to align with a Nationally consistent method of reporting of air quality data.

Each air quality measurement from a monitoring station is assigned an air quality category rating based on comparison of the measurement value against the relevant air quality guideline. Five colour-coded air quality categories are used, being 'Good' (green), 'Fair' (yellow), 'Poor' (orange), 'Very Poor' (red) or 'Extremely Poor' (dark red). Values greater than the air quality guideline will be appear as 'Poor', 'Very Poor' or 'Extremely Poor'.<sup>4</sup>

The Air Quality Categories rating is based on 1-hour average values.

**Table 6: Colour-coded Categories for Air Quality Categories** 

Not available	Good <50	Fair 50.1 - 100	Poor 100.1 - 200	Very Poor 200.1 - 600	Extremely Poor >600
---------------	-------------	--------------------	---------------------	--------------------------	---------------------

The  $PM_{10}$  1-hour average values for the reporting month in the stations P1, P2, P3 and P4 were assessed against the air quality category rating, and the pie chart on the next page presents the percentage of the days for which a specific air quality category was identified.

<sup>&</sup>lt;sup>4</sup> https://www.qld.gov.au/environment/pollution/monitoring/air-air-monitoring/air-quality-categories

Report No: DAT18172 Revision 1

**Port of Hay Point** 

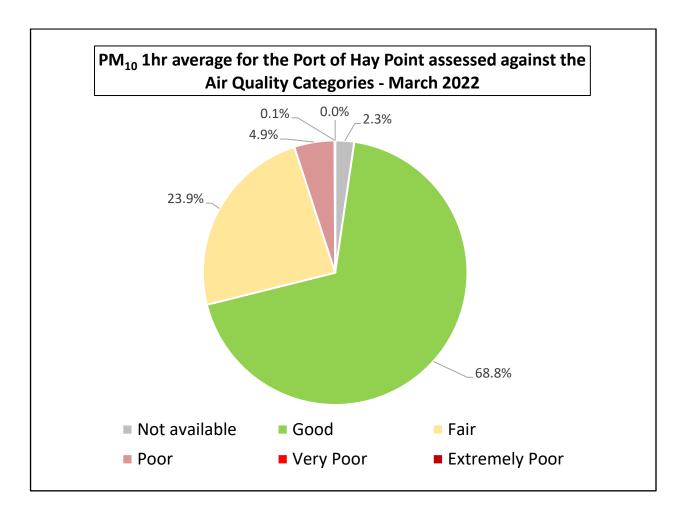


Figure 3: Hourly PM<sub>10</sub> Averages for the Port of Hay Point Assessed Against the Air Quality Index

The majority of the days during the reporting period (March 2022) presented Air Quality Index classified as Good (68.8%) or Fair (23.9%).

**Report No: DAT18172 Revision 1** 

**Port of Hay Point** 

#### 4.4. Graphic Representations

Validated 5-minute data for PM<sub>10</sub>, Wind speed, Wind direction, AT, RH, Rainfall and Noise were used to construct the following monthly graphic representations and summary tables.

For PM $_{10}$ , the licence limit is 50 µg/m $^3$  for the 24-hour average measured downwind of site. If the wind is from the South, sites P1 and P2 are downwind of site. If the wind is from the North, sites P3 and P4 are downwind of site. The following graph and table summarise the wind direction and PM $_{10}$  results for the month compared to the licence limit. Values highlighted in red in the table indicate a PM $_{10}$  exceedance. Values shaded in dark grey indicate wind direction from the North.

## Port of Hay Point PM<sub>10</sub> 24h average March 2022 PM<sub>10</sub> from P1 if WD from South PM<sub>10</sub> from P2 if WD from South PM<sub>10</sub> from P3 if WD from North PM<sub>10</sub> from P4 if WD from North 50 45 40 Gravimetric Concentration (µg/m³) 35 30 25 15 10 22 Tue 1 Fri Mar 2022

Figure 4: Port of Hay Point PM<sub>10</sub> 24-Hour Average Data Compared to the Licence Limit for March 2022

Report No: DAT18172 Revision 1

**Port of Hay Point** 

Table 7: Port of Hay Point Wind Direction and PM<sub>10</sub> 24h Average Data for March 2022

Date	PM <sub>10</sub> exceedence limit (μg/m³)	Wind direction <sup>5</sup>	P1 PM <sub>10</sub> (μg/m³)	P2 PM <sub>10</sub> (μg/m³)	P3 PM <sub>10</sub> (μg/m³)	P4 PM <sub>10</sub> (μg/m³)
1/03/2022	50.0	North	15	18	16	15
2/03/2022	50.0	North	17	24	22	-
3/03/2022	50.0	North	23	35	30	-
4/03/2022	50.0	North	22	33	27	-
5/03/2022	50.0	North	24	33	28	29
6/03/2022	50.0	North	22	39	26	27
7/03/2022	50.0	North	12	27	19	20
8/03/2022	50.0	North	21	26	24	23
9/03/2022	50.0	North	19	30	21	20
10/03/2022	50.0	North	10	15	12	16
11/03/2022	50.0	South	11	14	12	19
12/03/2022	50.0	South	20	22	29	51
13/03/2022	50.0	South	24	26	32	63
14/03/2022	50.0	South	17	19	23	47
15/03/2022	50.0	South	22	26	25	51
16/03/2022	50.0	South	19	20	22	38
17/03/2022	50.0	South	17	20	20	42
18/03/2022	50.0	South	18	20	21	45
19/03/2022	50.0	South	21	24	25	49
20/03/2022	50.0	South	22	25	25	49
21/03/2022	50.0	South	21	23	24	51
22/03/2022	50.0	South	15	18	16	29
23/03/2022	50.0	South	13	14	14	17
24/03/2022	50.0	South	10	17	12	15
25/03/2022	50.0	South	12	15	11	15
26/03/2022	50.0	South	16	21	16	34
27/03/2022	50.0	South	10	12	12	22
28/03/2022	50.0	South	11	12	12	15
29/03/2022	50.0	North	12	12	12	11
30/03/2022	50.0	North	9	12	14	11
31/03/2022	50.0	North	11	11	18	11

\_

<sup>&</sup>lt;sup>5</sup> Wind compass direction from "South" is >60 degrees and <240 degrees

#### Report No: DAT18172 Revision 1

## **Port of Hay Point**

The next graphs present the deposited dust results for the Total Insoluble Solids in comparison with the license limit for the reporting month<sup>6</sup>. The results are presented in two different graphs: one for the sites located to the North of the Terminal (S1, S2, S3, P1 and P2) and another for the sites located to the South of the Terminal (S5, S6, P3 and P4).

The Total Insoluble Solids are classified in 4 categories: organic matter (plant and animal material), fine dark particles (dark material), mineral fraction (light material) and other material such as plastics.

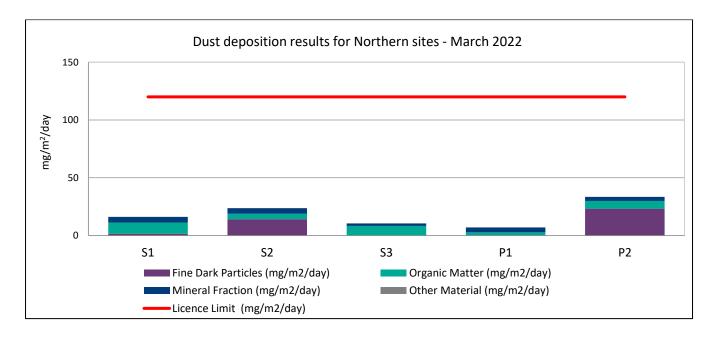


Figure 5: Dust Deposition Results for Northern Sites, March 2022

<sup>&</sup>lt;sup>6</sup> Results were provided to Ecotech by the SGS Cairns Environmental Laboratory.

## Report No: DAT18172 Revision 1

## **Port of Hay Point**

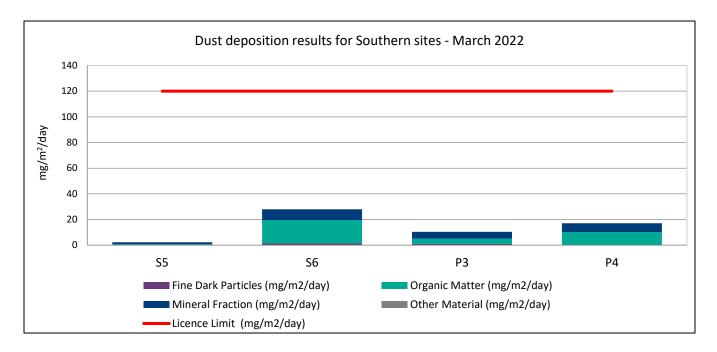


Figure 6: Dust Deposition Results for Southern Sites, March 2022

Total Insoluble Solids concentration for sites P1, P2, P3 and P4 was below the license. During March 2022, the prevailing wind direction was from the South (58% of the days).

Report No: DAT18172 Revision 1

## **Port of Hay Point**

Table 8 provides a summary of the average L<sub>A90</sub> values recorded at sites P1, P2, P3 and P4 during the reporting month. Result summaries and interpretations below are those provided by Marshall Day Acoustics.

Table 8: Noise Levels (LA90) Measured at P1, P2, P3 and P4 for March 2022

Location	L <sub>A90</sub> dB Average 12hr Level*	Standard deviation	Range
P1 Day	41	3.7	33 – 57
P1 Night	41	3.4	33 – 62
P2 Day	47	3.6	37 – 59
P2 Night	49	3.6	37 – 57
P3 Day	47	2.3	42 – 61
P3 Night	47	2.2	43 – 65
P4 Day	47	3.8	41 – 58
P4 Night	48	4.1	41 - 59

<sup>\*</sup>Average of L<sub>A90</sub>, 15 min for the day and evening periods

**Note**: The recorded noise levels include extraneous noise and weather-related events, and are not pure component sound levels.

The average  $L_{A90}$  sound pressure levels at all monitoring locations (including adverse weather and other extraneous noise sources) were below the corresponding target noise levels or the Day and Night periods.

Sound levels measured throughout March 2022 at monitoring locations P1, P2, P3 and P4 have been plotted in Figures 7 to Figure 10 respectively.

Report No: DAT18172 Revision 1

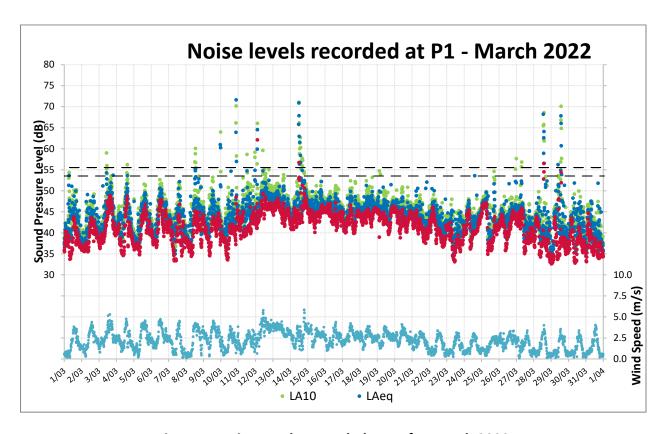


Figure 7: Noise Levels Recorded at P1 for March 2022

Report No: DAT18172 Revision 1

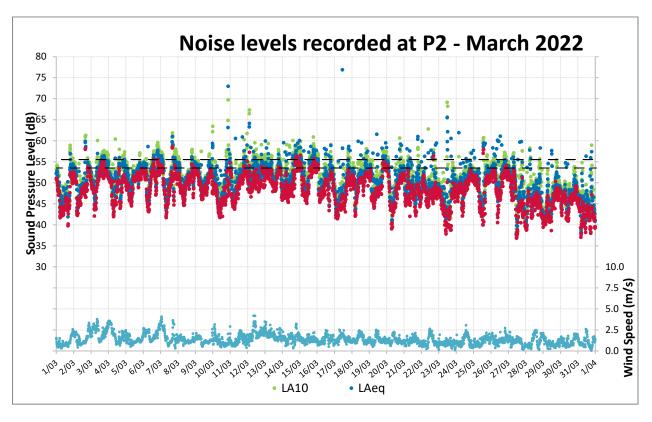


Figure 8: Noise Levels Recorded at P2 for March 2022

Report No: DAT18172 Revision 1

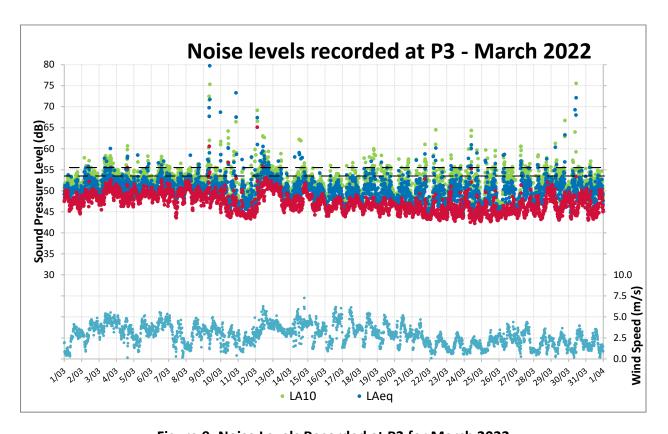


Figure 9: Noise Levels Recorded at P3 for March 2022

Report No: DAT18172 Revision 1

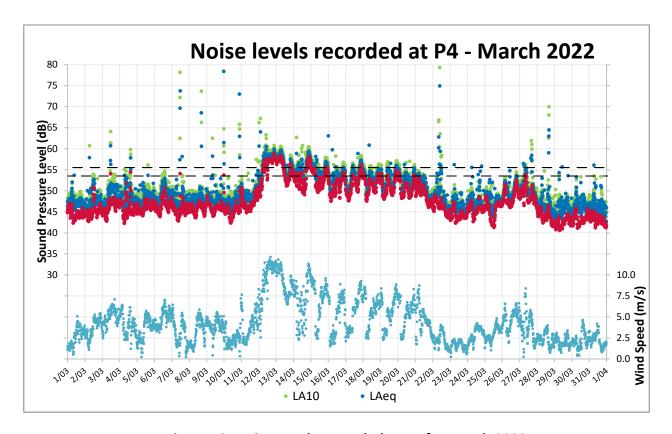


Figure 10: Noise Levels Recorded at P4 for March 2022

# Report No: DAT18172 Revision 1


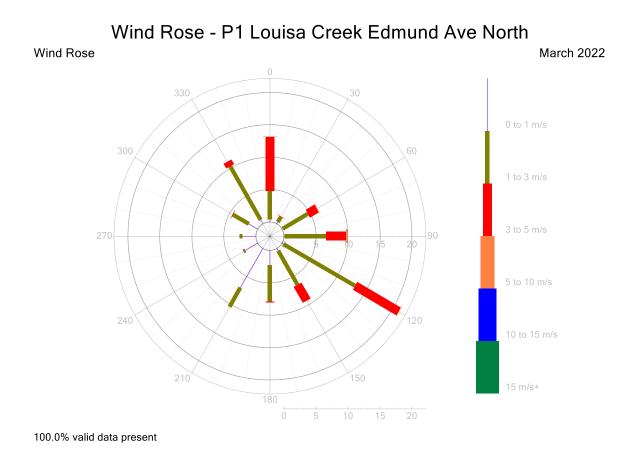


Figure 11: P1 Wind Rose 5-Minute Data for March 2022

# Report No: DAT18172 Revision 1

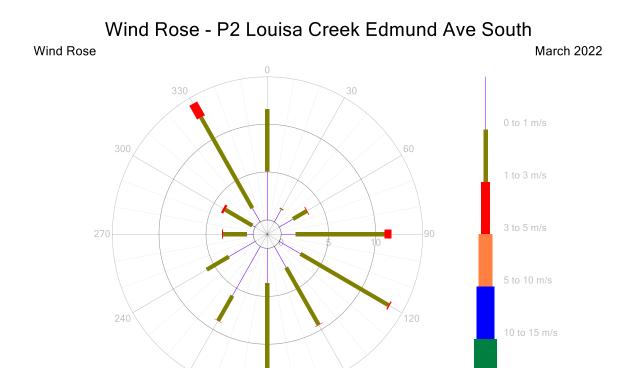

100.0% valid data present

Figure 12: P2 Wind Rose 5-Minute Data for March 2022

# Report No: DAT18172 Revision 1

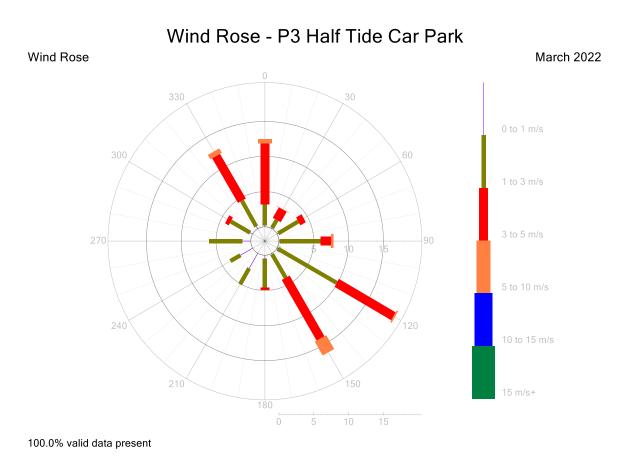


Figure 13: P3 Wind Rose 5-Minute Data for March 2022

Report No: DAT18172 Revision 1

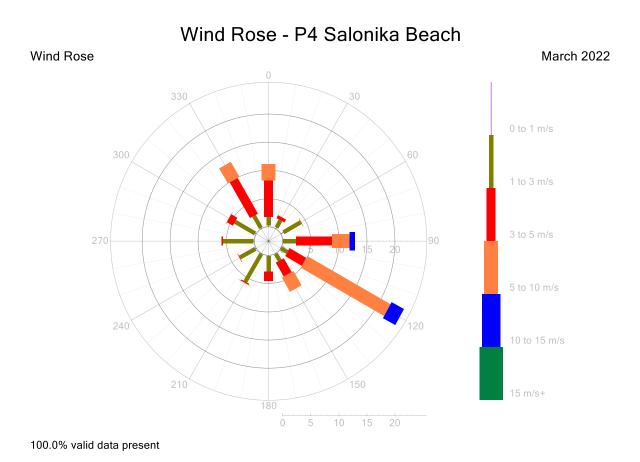


Figure 14: P4 Wind Rose 5-Minute Data for March 2022

Report No: DAT18172 Revision 1

**Port of Hay Point** 

# Ambient Temperature 5-Minute Averages - P3 Half Tide Car Park March 2022

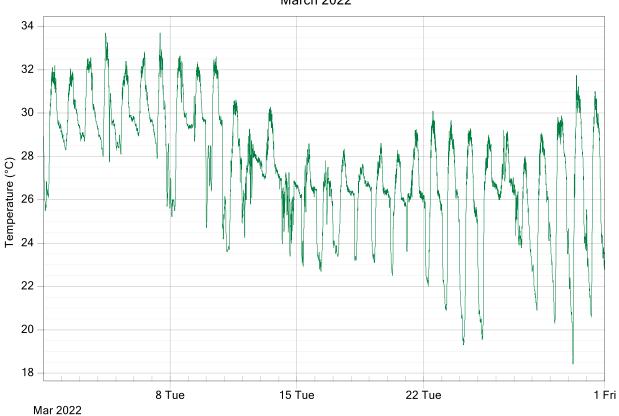


Figure 15: Port of Hay Point AT 5-Minute Averages Data for March 2022

Report No: DAT18172 Revision 1

**Port of Hay Point** 

## Relative Humidity 5-Minute Averages - P3 Half Tide Car Park

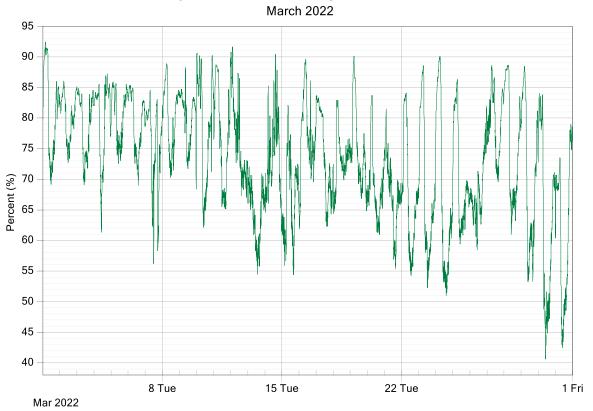


Figure 16: Port of Hay Point RH 5-Minute Averages Data for March 2022

Report No: DAT18172 Revision 1

**Port of Hay Point** 

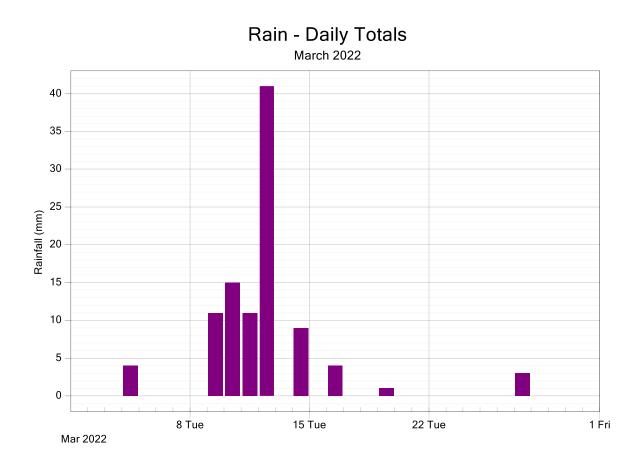


Figure 17: Port of Hay Point Rain Daily Totals for March 2022

------ END OF REPORT -----

## Report No: DAT18172 Revision 1

## **Port of Hay Point**

## **Appendix 1 - Definitions & Abbreviations**

°C Degrees Celsius

μg/m³ Micrograms per cubic meter at standard temperature and pressure (0°C and 101.3

kPa)

AT Ambient Temperature

atm Atmosphere

calm Wind conditions where the wind speed is below the operating range of the wind

sensor

dBa A-weighted decibels

deg Degrees (True North)

m/s Meters per second

mg/m<sup>2</sup> Milligrams per square meter

PM<sub>10</sub> Particulate less than 10 microns in equivalent aerodynamic diameter

RH Relative Humidity

TSP Total suspended particulates

WD Vector Wind Direction

WS Vector Wind Speed

Report No: DAT18172 Revision 1

**Port of Hay Point** 

#### **Appendix 2 – Amendments**

This amended report supersedes previously issued versions of the report. Refer to the revision history table on page 2 for details of previous revisions. The following modifications have been made in this revision:

- Corrected the Dust Deposition Gauge (DDG) results for Dust 1mm Observations for lines
   32 37 in the accompanying DBCT Monthly Validated Data Report Mar-22
- Updated the DDG results for P2 2203 Louisa Creek, Edmund Ave (South) in the accompanying DBCT Monthly Validated Data Report Mar-22 following re-analysis by SGS as requested by DBCT
- Updated the graphs for Figure 18: Dust Deposition Results for Northern Sites, March 2022 and Figure 19: Dust Deposition Results for Southern Sites, March 2022 following the correction of the DDG results as mentioned above

No further changes have been made to this report.