

Port of Hay Point

Ambient Air, Noise and Weather Monitoring

Validated Report

1st August – 31st August 2022

Report No.: DAT18845

Report issue date: 28th September 2022

Maintenance contract: MC2099

ACOEM AUSTRALASIA (ECOTECH PTY LTD.) ABN: 32005752081

1492 Ferntree Gully Rd, Knoxfield VIC. 3180. AUSTRALIA

Tel No: 1300 364 946 Fax No: 1300 668 763

Email info.au@acoem.com WEB www.acoem.com.au

This document shall not be reproduced except for in full, without the written approval of Acoem Australasia (Ecotech Pty Ltd)

Report No: DAT18845

Port of Hay Point

| Customer Details | | | |
|---|----------------|--|--|
| Customer Dalrymple Bay Coal Terminal (DBCT) Pty Ltd | | | |
| Contact name Environmental Services Team | | | |
| Address Martin Armstrong Drive, Hay Point, QLD 4740 | | | |
| Email EnvironmentalServicesTeam@dbct.com.au | | | |
| Phone | (07) 4943 8444 | | |

| Revision History | | | | | |
|---------------------------------|----------|------------|----------|--|--|
| Revision Report ID Date Analyst | | | | | |
| 0 | DAT18845 | 28/09/2022 | Xinyu Ke | | |

Report by: Xinyu Ke

Approved Signatory: Jon Alexander

Report No: DAT18845

Port of Hay Point

Table of Contents

| Customer | Details | 2 |
|-------------|--|----|
| Revision H | History | 2 |
| Table of C | Contents | 3 |
| List of Fig | ures | 4 |
| List of Tab | oles | 5 |
| 1.0 Intro | duction | 6 |
| 1.1. Pu | urpose of monitoring | 6 |
| 2.0 Mon | itoring and Data Collection | 7 |
| 2.1. Sit | ting Details | 7 |
| 2.2. M | onitored Parameters | 10 |
| 2.3. Da | ata Collection Methods | 12 |
| 2.3.1. | Data Acquisition | 13 |
| 2.3.2. | Sampling and analysis for Rain | 13 |
| 2.3.3. | Sampling and analysis for Noise | 13 |
| 2.3.4. | Sampling and analysis for Deposited Dust | 13 |
| 2.4. Da | ata Validation and Reporting | 14 |
| 2.4.1. | Validation | 14 |
| 2.4.2. | Reporting | 14 |
| 3.0 Air Q | Quality Objectives | 16 |
| 4.0 Resu | lts | 17 |
| 4.1. Da | ata Capture | 17 |
| 4.2. Co | omplaints | 18 |

Report No: DAT18845

| 4.3. | Air Quality Summary18 |
|-------------|--|
| 4.3.1 | Air Quality Categories18 |
| 4.4. | Graphic Representations |
| Appendix | 1 - Definitions & Abbreviations36 |
| | |
| List of F | igures |
| Figure 1: F | Port of Hay Point Residential, Rain Gauge and Control Monitoring Stations Location8 |
| Figure 2: [| Detail of the Port of Hay Point Residential Stations Location and Rain Gauge9 |
| Figure 3: F | Hourly PM_{10} Averages for the Port of Hay Point Assessed Against the Air Quality Index19 |
| Figure 4: P | Port of Hay Point PM_{10} 24-Hour Average Data Compared to the Licence Limit for August 202220 |
| Figure 5: [| Oust Deposition Results for Northern Sites, August 2022 |
| Figure 6: [| Oust Deposition Results for Southern Sites, August 2022 |
| Figure 7: N | Noise Levels Recorded at P1 for August 202225 |
| Figure 8: N | Noise Levels Recorded at P2 for August 202226 |
| Figure 9: N | Noise Levels Recorded at P3 for August 202227 |
| Figure 10: | Noise Levels Recorded at P4 for August 202228 |
| Figure 11: | P1 Wind Rose 5-Minute Data for August 202229 |
| Figure 12: | P2 Wind Rose 5-Minute Data for August 202230 |
| Figure 13: | P3 Wind Rose 5-Minute Data for August 202231 |
| Figure 14: | P4 Wind Rose 5-Minute Data for August 202232 |
| Figure 15: | Port of Hay Point AT 5-Minute Averages Data for August 2022 |
| Figure 16: | Port of Hay Point RH 5-Minute Averages Data for August 202234 |
| Figure 17: | Port of Hay Point Rain Daily Totals for August 202235 |

Report No: DAT18845

Port of Hay Point

List of Tables

| Table 1: Port of Hay Point Residential and Control Monitoring Sites Locations | 7 |
|---|----|
| Table 2: Parameters measured at the Port of Hay Point Residential and Control Monitoring Stations | 10 |
| Table 3: Methods | 12 |
| Table 4: Port of Hay Point Air Quality Objectives | 16 |
| Table 5: P1-P4 Data Capture for August 2022 | 17 |
| Table 6: Colour-coded Categories for Air Quality Categories | 18 |
| Table 7: Port of Hay Point Wind Direction and PM $_{ m 10}$ 24h Average Data for August 2022 | 21 |
| Table 8: Noise Levels (LA90) Measured at P1, P2, P3 and P4 for August 2022 | 24 |

Report No: DAT18845

Port of Hay Point

1.0 Introduction

Acoem Australasia (Ecotech Pty Ltd) was commissioned by North Queensland Bulk Ports Corporation (NQBP), Dalrymple Bay Coal Terminal Pty Ltd (DBCT P/L) and BMA Hay Point Coal Terminal (HPCT) to provide monitoring and data reporting for the Port of Hay Point environmental monitoring program in Hay Point, Queensland. Acoem Australasia (Ecotech) commenced services under the ambient air quality monitoring program Contract SA294.2016 on the 1st of March 2017.

This report presents the data for August 2022.

The data presented in this report:

- Describes air quality measurements;
- Compares monitoring results;
- Has been quality assured.

1.1. Purpose of monitoring

This Ambient Air Monitoring Program has been established to proactively monitor ambient air, noise and meteorological conditions in the community surrounding the Port of Hay Point. The program consists of two control stations (C1 and C2), nine ambient air quality monitoring stations (P1, P2, P3, P4, S1, S2, S3, S5 and S6) and one rain gauge as described in Table 1.

Since the commencement of this monitoring program in 1993, Louisa Creek township has been identified as future strategic port land. NQBP have introduced a voluntary residential buy back scheme and taken steps to prevent residential re-intensification in zones immediately adjacent to the Port. Subsequently the monitoring station P2 is no longer in as populated residential location as when the program initially began.

Report No: DAT18845

Port of Hay Point

2.0 Monitoring and Data Collection

2.1. Siting Details

The Sites consist of two Control stations (C1 and C2), nine Residential ambient air quality monitoring stations (P1, P2, P3, P4, S1, S2, S3, S5 and S6) and one Rain Gauge. The stations' location and siting details are described in the following table and figures.

Table 1: Port of Hay Point Residential and Control Monitoring Sites Locations

| Site Name | Geographical Coordinates | Height Above Sea Level (m) |
|--|-------------------------------|-------------------------------|
| C1 - Grasstree Beach (South) | 21°21'54.71"S, 149°18'25.60"E | 8 |
| C2 - Grasstree Beach (North) | 21°22'3.06"S, 149°18'27.19"E | 10 |
| P1 - Louisa Creek, Edmund Avenue (North) | 21°16'21.43"S, 149°15'47.96"E | 6 |
| P2 - Louisa Creek, Edmund Avenue (South) | 21°16'48.46"S, 149°16'34.64"E | 10 |
| P3 - Half Tide Car Park | 21°17'45.34"S, 149°17'21.76"E | 9 |
| P4 - Salonika Beach | 21°18'29.32"S, 149°17'33.64"E | 12 |
| S1 - Louisa Creek (North) | 21°16'35.88"S, 149°16'14.42"E | 1 |
| S2 - Louisa Creek (South) | 21°16'46.88"S, 149°16'29.00"E | 4 |
| S3 – Osborne's Residence | 21°17'23.20"S, 149°16'10.05"E | 15 |
| S5 - Salonika Beach | 21°18'11.60"S, 149°17'35.24"E | 13 |
| S6 - Half Tide Beach | 21°17'56.83"S, 149°17'31.84"E | 9 |
| Rain Gauge | 21°17'23.52"S, 149°17'17.41"E | 7 |

Report No: DAT18845

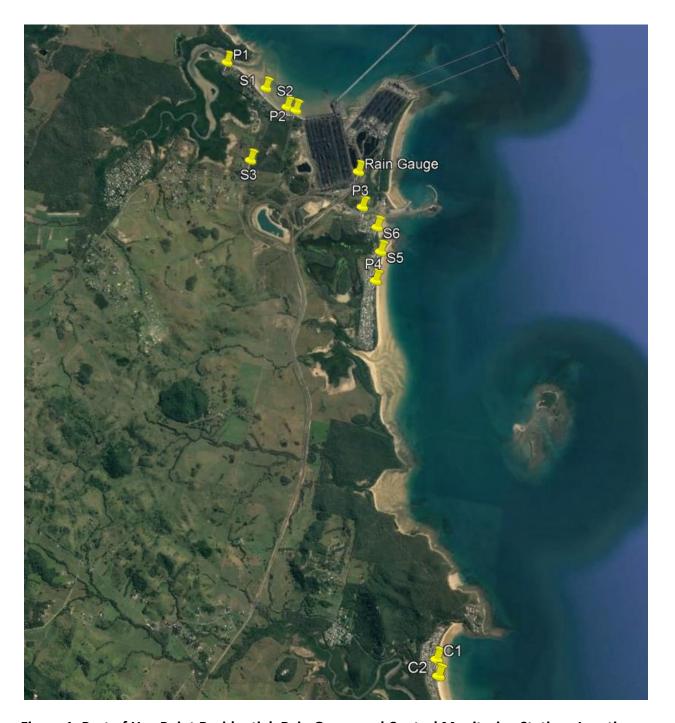


Figure 1: Port of Hay Point Residential, Rain Gauge and Control Monitoring Stations Location

Report No: DAT18845



Figure 2: Detail of the Port of Hay Point Residential Stations Location and Rain Gauge

Report No: DAT18845

Port of Hay Point

2.2. Monitored Parameters

Table 2 details the parameters monitored and the instruments used at Port of Hay Point Residential and Control monitoring stations. Appendix 1 defines any abbreviated parameter names used throughout the report.

Sampling of all parameters is continuous, with the exception of Deposited dust. Deposited dust is captured over a one-month period and the sample bottles collected once a month.

For meteorological sensors, the elevation given in the table below is the height above ground level at the monitoring station.

Table 2: Parameters measured at the Port of Hay Point Residential and Control Monitoring Stations

| Site Code | Parameter Measured | Instrument and Measurement Technique | |
|----------------------------------|---|---|--|
| C1, C2, S1, S2, S3, S5 and S6 | Deposited Particulate Matter | Dust Deposition Gauge | |
| | Deposited Particulate Matter | Dust Deposition Gauge | |
| | PM ₁₀ | Thermo – TEOM 1405 (Tapered Element Oscillating Microbalance) | |
| P3 | Wind Speed (Horizontal, elevation 10m) | Vaisala WXT520 Multi-sensor Weather Monitor | |
| | Wind Direction (Elevation 10m) | Vaisala WXT520 Multi-sensor Weather Monitor | |
| | Ambient Temperature (Elevation 10m) | Vaisala WXT520 Multi-sensor Weather Monitor | |
| | Relative Humidity (Elevation 10m) | Vaisala WXT520 Multi-sensor Weather Monitor | |
| | Noise | Class 1 Brüel & Kjær 2250 Sound Level Meter | |
| P1, P2 and P4 | Deposited Particulate Matter | Dust Deposition Gauge | |

Report No: DAT18845

Port of Hay Point

| Site Code | Parameter Measured | Instrument and Measurement Technique | | |
|------------|--|---|--|--|
| | PM ₁₀ | Thermo – TEOM 1405 (Tapered Element Oscillating Microbalance) | | |
| | Wind Speed (horizontal, elevation 10m) | Gill Windsonic Op1 | | |
| | Wind Direction (elevation 10m) | Gill Windsonic Op1 | | |
| | Noise | Class 1 Brüel & Kjær 2250 Sound Level Meter | | |
| Rain Gauge | Rainfall | Hydrological Services tipping bucket rain gauge - Model TB3 | | |

Since the beginning of the project in March 2017 until the 9th of July 2018, the TEOMs at sites P1, P2, P3 and P4 were configured to measure TSP. After this date, measurements were changed to PM₁₀ due to updates to the Dalrymple Bay Coal Terminal Pty Ltd and Hay Point Environmental Authority Permit¹.

¹ Department of Environment and Heritage Protection Environmental Authority Permits EPPR00474413 and EPPR00504513.

Report No: DAT18845

Port of Hay Point

2.3. Data Collection Methods

Table 3 below shows the methods used for data collection.

Table 3: Methods

| Parameter Measured | Data Collection Methods Used | Description of Method | | |
|---|---------------------------------|---|--|--|
| Deposited Particulate Matter (Sampling by Acoem Australasia (Ecotech)) As/NZS 3580.10.1 2016 | | Methods for sampling and analysis of ambient air. Method 10.1: Determination of particulate matter—Deposited matter—Gravimetric method | | |
| Deposited Particulate Matter (Analysis by SGS) | AN502 (Sydney) /AN503 | The mass deposition rate of deposited matter is calculated from the mass of solids obtained, the funnel cross-section area and the exposure period. | | |
| PM ₁₀ (TEOM) AS/NZ 3580.9.8-2008 | | Methods for sampling and analysis of ambient air. Method 9.8: Determination of suspended particulate matter - PM ₁₀ continuous direct mass method using a tapered element oscillating microbalance analyser. | | |
| Vector Wind Speed (Horizontal) AS/NZS 3580.14 2014 | | Methods for sampling and analysis of ambient air. Method 14: Meteorological monitoring for ambient air quality monitoring applications | | |
| Vector Wind Direction AS/NZS 3580.14 2014 | | Methods for sampling and analysis of ambient air. Method 14: Meteorological monitoring for ambient air quality monitoring applications | | |
| Ambient Temperature AS/NZS 3580.14 2014 | | Methods for sampling and analysis of ambient air. Method 14: Meteorological monitoring for ambient air quality monitoring applications | | |
| Relative Humidity AS/NZS 3580.14 2014 | | Methods for sampling and analysis of ambient air. Method 14: Meteorological monitoring for ambient air quality monitoring applications | | |
| Rain (Sampling by AS/NZS 3580.14 2014 external contractor) | | Methods for sampling and analysis of ambient air. Method 14: Meteorological monitoring for ambient air quality monitoring applications. Rainfall by tipping bucket rain gauge | | |
| Noise (L _{eq} , L ₁₀ and L ₉₀) (Analysis by Marshall Day Acoustics) DEHP Noise Measurement Manual (2013) and AS 1055.1: 1997 | | Acoustics - Description and measurement of environmental noise - Part 1: General procedures | | |

Report No: DAT18845

Port of Hay Point

2.3.1. Data Acquisition

Data acquisition for continuously monitored parameters, with the exception of noise and rain, is performed using an Envista logger situated at each of the monitoring sites. Each logger is equipped with a 4G modem for remote data collection. The recorded data is remotely collected and transferred via FTP at 10-minute intervals (using Airodis[™] version 5.2) and stored at Acoem Australasia (Ecotech) Environmental Reporting Services (ERS) department in Melbourne, Australia. Data samples are logged in 5-minute intervals.

2.3.2. Sampling and analysis for Rain

Rain sampling and analysis are conducted by an external contractor. The 5-minute data is sent monthly to Acoem Australasia (Ecotech) by Dalrymple Bay Coal Terminal Pty Ltd (DBCT P/L).

2.3.3. Sampling and analysis for Noise

Noise data samples are logged in 5-minute intervals. The data is downloaded monthly by Acoem Australasia (Ecotech) field service technicians and sent to Marshall Day Acoustics for analysis.

2.3.4. Sampling and analysis for Deposited Dust

Deposited dust sampling is conducted by Acoem Australasia (Ecotech) field service technicians. Sample bottles are sent to SGS Cairns Environmental Laboratory for analysis. The laboratory is NATA accredited for compliance with ISO/IEC 17025:2005 (Acc. No. 2562, Site No.3146).

Report No: DAT18845

Port of Hay Point

2.4. Data Validation and Reporting

2.4.1. Validation

The Acoem Australasia (Ecotech) ERS department perform daily data checks on continuously monitored parameters (with the exception of noise and rainfall data) to ensure maximum data capture rates are maintained. Any equipment failures are communicated to the responsible field engineers for urgent rectification. Acoem Australasia (Ecotech) ERS maintains two distinct databases containing non-validated and validated data respectively.

The validated database is created by duplicating the non-validated database and then flagging data affected by instrument faults, calibrations and other maintenance activities. The data validation software requires the analyst to supply a valid reason (e.g., backed by maintenance notes, calibration sheets etc.) in the database for flagging any data as invalid.

Details of all invalid or missing data are recorded in the Valid Data Exception Tables.

Validation is performed by the analyst, and the validation is reviewed. Graphs and tables are generated based on the validated five-minute data.

Note: Validation for noise data is performed by the subcontractor Marshall Day Acoustics.

2.4.2. Reporting

The data contained in this report is based on Australian Eastern Standard Time.

All averages are calculated from the five-minute data. Averages are based on a minimum of 75% valid readings within the averaging period. Where data capture is low for a particular parameter, summary values (e.g., monthly maximum and minimum) may be based on less than 75% valid samples.

The reader should use caution when interpreting these values as they may not be representative of conditions for the entire sample period.

Averaging periods of eight hours or less are reported for the end of the period, i.e., the hourly average 02:00am is for the data collected from 1:00am to 2:00am. One-hour averages are calculated based on a clock hour. One day averages are calculated based on calendar days.

Rain Reporting

Rain results are provided to Acoem Australasia (Ecotech) by Dalrymple Bay Coal Terminal Pty Ltd (DBCT P/L) and included in this report.

Report No: DAT18845

Port of Hay Point

Deposited Dust Reporting

Deposited dust results are provided to Acoem Australasia (Ecotech) by the SGS Cairns Environmental Laboratory and summarised within this report.

Noise Data Reporting

Noise levels results are provided to Acoem Australasia (Ecotech) by Marshall Day Acoustics and summarised within this report.

Wind Data Reporting

Wind speed and wind direction data associated with calm wind conditions are reported in accordance with the requirements of *AS/NZS 3580.14-2014*. Calm wind conditions are defined as wind speeds below the starting threshold of the wind speed/direction sensors.

In Table 7 on page 21, "South" describes the wind direction arc between the compass points of >60 degrees and <240 degrees. "North" describes wind direction arc between the compass points of >240 degrees and more <60 degrees.

Report No: DAT18845

Port of Hay Point

3.0 Air Quality Objectives

The air quality objectives monitored at the Port of Hay Point monitoring network sites are taken from the Dalrymple Bay Coal Terminal Pty Ltd and Hay Point Environmental Authority Permit².

The air quality objectives are shown in Table 4 below.

Table 4: Port of Hay Point Air Quality Objectives

| Parameter | Time Period | Licence Limit | Units |
|---|--|--|-----------|
| Deposited Dust – Total Insoluble Solids | 1 day: based on 1 month sampling | 120 mg/m²/day | mg/m²/day |
| PM ₁₀ | 1 day | 50 μg/m³ – when generated by port activities and measured at any sensitive or commercial place | μg/m³ |
| L _{A90} | 15 min | Day level (7am – 7pm) = 55 dB(A) Night level (7pm – 7am) = 53 dB(A) | dB(A) |

² Department of Environment and Heritage Protection Environmental Authority Permits EPPR00474413 and EPPR00504513.

Report No: DAT18845

Port of Hay Point

4.0 Results

4.1. Data Capture

Data capture is based on 5-minute data and refers to the amount of available data collected during the report period. The percentage of data captured is calculated using the following equation:

Data capture = (Reported air quality data / Total data) x 100%

Where:

- Reported air quality data = Number of instrument readings which have been validated through a quality assured process and excludes all data errors, zero data collection due to calibration, failures and planned and unplanned maintenance.
- Total data = Total number of instrument readings since the start of the term assuming no maintenance, errors, loss of data or calibration.

Table 5 displays data capture statistics for the reporting period (August 2022). **Bold** values in the table indicate data capture below 90%.

Table 5: P1-P4 Data Capture for August 2022

| | Data Capture (%) | | | |
|------------------|------------------|-------|-------|-------|
| Parameter | P1 | P4 | | |
| PM ₁₀ | 99.6 | 99.7 | 99.8 | 99.7 |
| WS and WD | 100.0 | 100.0 | 100.0 | 99.8 |
| AT ³ | | | 100.0 | |
| RH | | | 100.0 | |
| Noise | 100.0 | 100.0 | 100.0 | 100.0 |

The data capture for all of the parameters at sites P1, P2, P3 and P4 was above 90% for the reporting month except for Noise data capture at site P1 and P3 due to intermittent measurement data gaps. The overall monthly percentage of data captured for the 11 Dust Deposition Gauges was 100.0%.

³ AT and RH parameters are only measured at P3 station.

Report No: DAT18845

Port of Hay Point

4.2. Complaints

There were no external contacts regarding dust received by the PoHP terminals during August 2022.

4.3. Air Quality Summary

4.3.1. Air Quality Categories

Air quality categories rather than an air quality index have been adopted to align with a Nationally consistent method of reporting of air quality data.

Each air quality measurement from a monitoring station is assigned an air quality category rating based on comparison of the measurement value against the relevant air quality guideline. Five colour-coded air quality categories are used, being 'Good' (green), 'Fair' (yellow), 'Poor' (orange), 'Very Poor' (red) or 'Extremely Poor' (dark red). Values greater than the air quality guideline will be appear as 'Poor', 'Very Poor' or 'Extremely Poor'.⁴

The Air Quality Categories rating is based on 1-hour average values.

Table 6: Colour-coded Categories for Air Quality Categories

| Not available | Good | Fair | Poor | Very Poor | Extremely Poor |
|----------------|------|------------|-------------|-------------|----------------|
| 110t available | <50 | 50.1 - 100 | 100.1 - 200 | 200.1 - 600 | >600 |

The PM_{10} 1-hour average values for the reporting month in the stations P1, P2, P3 and P4 were assessed against the air quality category rating, and the pie chart on the next page presents the percentage of the days for which a specific air quality category was identified.

⁴ https://www.qld.gov.au/environment/pollution/monitoring/air/air-monitoring/air-quality-categories

Report No: DAT18845

Port of Hay Point

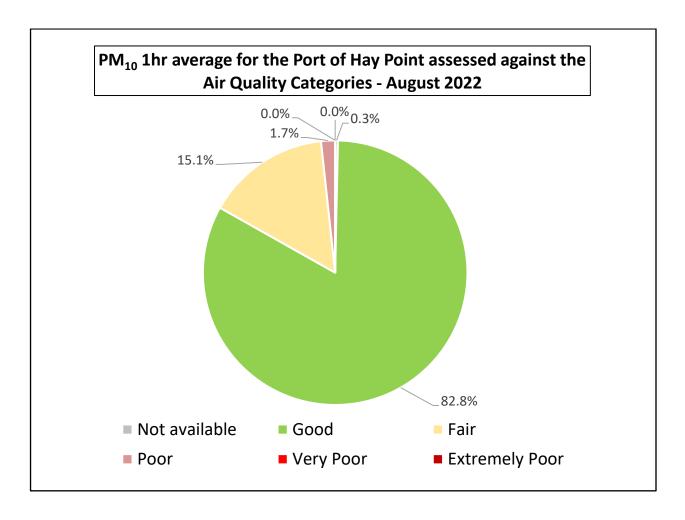


Figure 3: Hourly PM₁₀ Averages for the Port of Hay Point Assessed Against the Air Quality Index

The majority of the days during the reporting period (August 2022) presented Air Quality Index classified as Good (82.8%) or Fair (15.1%).

Report No: DAT18845

Port of Hay Point

4.4. Graphic Representations

Validated 5-minute data for PM₁₀, Wind speed, Wind direction, AT, RH, Rainfall and Noise were used to construct the following monthly graphic representations and summary tables.

For PM $_{10}$, the licence limit is 50 µg/m 3 for the 24-hour average measured downwind of site. If the wind is from the South, sites P1 and P2 are downwind of site. If the wind is from the North, sites P3 and P4 are downwind of site. The following graph and table summarise the wind direction and PM $_{10}$ results for the month compared to the licence limit. Values highlighted in red in the table indicate a PM $_{10}$ exceedance. Values shaded in dark grey indicate wind direction from the North.

Port of Hay Point PM₁₀ 24h average August 2022 PM₁₀ from P1 if WD from South PM₁₀ from P2 if WD from South PM₁₀ from P3 if WD from North PM₁₀ from P4 if WD from North 50 45 40 Gravimetric Concentration (µg/m³) 30 25 20 15 15 Mon 1 Thu 8 Mon Aug 2022

Figure 4: Port of Hay Point PM₁₀ 24-Hour Average Data Compared to the Licence Limit for August 2022

Report No: DAT18845

Port of Hay Point

Table 7: Port of Hay Point Wind Direction and PM₁₀ 24h Average Data for August 2022

| Date | PM ₁₀ exceedence limit (μg/m³) | Wind direction ⁵ | P1 PM ₁₀ (μg/m³) | P2 PM ₁₀ (μg/m³) | P3 PM ₁₀ (μg/m³) | P4 PM ₁₀ (μg/m³) |
|------------|---|--------------------------------|--------------------------------|--------------------------------|--------------------------------|--------------------------------|
| 1/08/2022 | 50.0 | South | 14 | 14 | 15 | 19 |
| 2/08/2022 | 50.0 | South | 11 | 11 | 11 | 13 |
| 3/08/2022 | 50.0 | South | 9 | 12 | 10 | 12 |
| 4/08/2022 | 50.0 | South | 10 | 12 | 11 | 11 |
| 5/08/2022 | 50.0 | North | 9 | 9 | 15 | 10 |
| 6/08/2022 | 50.0 | North | 9 | 10 | 15 | 11 |
| 7/08/2022 | 50.0 | South | 11 | 12 | 13 | 15 |
| 8/08/2022 | 50.0 | South | 9 | 13 | 17 | 23 |
| 9/08/2022 | 50.0 | South | 9 | 13 | 11 | 17 |
| 10/08/2022 | 50.0 | South | 16 | 18 | 19 | 26 |
| 11/08/2022 | 50.0 | South | 17 | 18 | 19 | 31 |
| 12/08/2022 | 50.0 | South | 14 | 15 | 14 | 21 |
| 13/08/2022 | 50.0 | South | 9 | 11 | 12 | 11 |
| 14/08/2022 | 50.0 | South | 10 | 11 | 13 | 12 |
| 15/08/2022 | 50.0 | South | 12 | 14 | 18 | 13 |
| 16/08/2022 | 50.0 | North | 11 | 10 | 14 | 12 |
| 17/08/2022 | 50.0 | South | 12 | 14 | 17 | 21 |
| 18/08/2022 | 50.0 | South | 14 | 15 | 15 | 15 |
| 19/08/2022 | 50.0 | North | 15 | 15 | 18 | 20 |
| 20/08/2022 | 50.0 | South | 15 | 15 | 18 | 20 |
| 21/08/2022 | 50.0 | South | 18 | 20 | 21 | 32 |
| 22/08/2022 | 50.0 | South | 23 | 24 | 25 | 38 |
| 23/08/2022 | 50.0 | South | 19 | 19 | 23 | 24 |
| 24/08/2022 | 50.0 | South | 15 | 22 | 22 | 29 |
| 25/08/2022 | 50.0 | South | 14 | 19 | 17 | 27 |
| 26/08/2022 | 50.0 | South | 19 | 22 | 22 | 33 |
| 27/08/2022 | 50.0 | South | 22 | 24 | 24 | 41 |
| 28/08/2022 | 50.0 | South | 25 | 27 | 29 | 50 |
| 29/08/2022 | 50.0 | South | 18 | 20 | 21 | 29 |
| 30/08/2022 | 50.0 | South | 17 | 19 | 21 | 33 |
| 31/08/2022 | 50.0 | South | 11 | 12 | 12 | 18 |

_

⁵ Wind compass direction from "South" is >60 degrees and <240 degrees

Report No: DAT18845

Port of Hay Point

The next graphs present the deposited dust results for the Total Insoluble Solids in comparison with the license limit for the reporting month⁶. The results are presented in two different graphs: one for the sites located to the North of the Terminal (S1, S2, S3, P1 and P2) and another for the sites located to the South of the Terminal (S5, S6, P3 and P4).

The Total Insoluble Solids are classified in 4 categories: organic matter (plant and animal material), fine dark particles (dark material), mineral fraction (light material) and other material such as plastics.

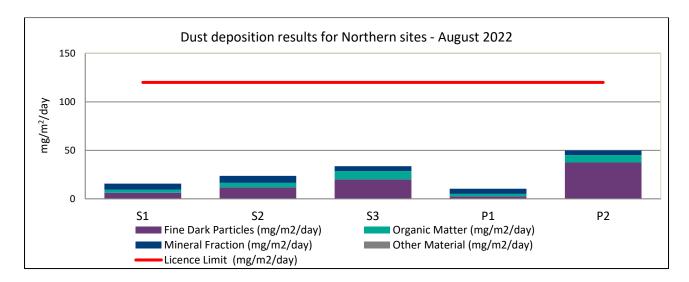


Figure 5: Dust Deposition Results for Northern Sites, August 2022

⁶ Dust deposition results were provided to Acoem by the SGS Cairns Environmental Laboratory.

Report No: DAT18845

Port of Hay Point

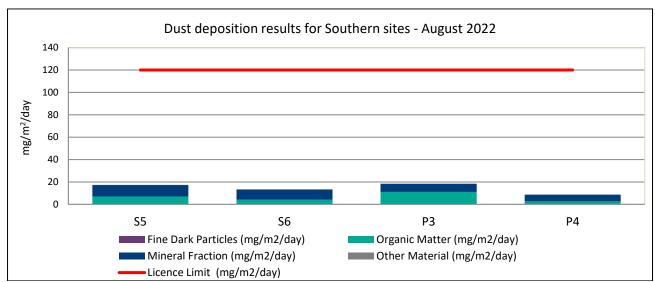


Figure 6: Dust Deposition Results for Southern Sites, August 2022

Total Insoluble Solids concentration for sites P1, P2, P3 and P4 was below the license limit. During August 2022, the prevailing wind direction was from the South (87.1% of the days).

Report No: DAT18845

Port of Hay Point

Table 8 provides a summary of the average L_{A90} values recorded at sites P1, P2, P3 and P4 during the reporting month. Result summaries and interpretations below are those provided by Marshall Day Acoustics.

Table 8: Noise Levels (LA90) Measured at P1, P2, P3 and P4 for August 2022

| Location | L _{A90} dB Average 12hr Level* | Standard deviation | Range |
|----------|--|--------------------|---------|
| P1 Day | 41 | 3.6 | 31 - 50 |
| P1 Night | 43 | 4.3 | 31 - 49 |
| P2 Day | 49 | 3.8 | 38 - 57 |
| P2 Night | 50 | 3.6 | 39 - 58 |
| P3 Day | 45 | 1.6 | 41 - 52 |
| P3 Night | 45 | 2.4 | 41 - 54 |
| P4 Day | 48 | 3.2 | 42 - 56 |
| P4 Night | 48 | 3.2 | 42 - 57 |

^{*}Average of L_{A90}, 15 min for the day and evening periods

Note: The recorded noise levels include extraneous noise and weather-related events, and are not pure component sound levels.

The average L_{A90} sound pressure levels at all monitoring locations (including adverse weather and other extraneous noise sources) were below the corresponding target noise levels or the Day and Night periods.

Sound levels measured throughout August 2022 at monitoring locations P1, P2, P3 and P4 have been plotted in Figures 7 to Figure 10 respectively.

Report No: DAT18845

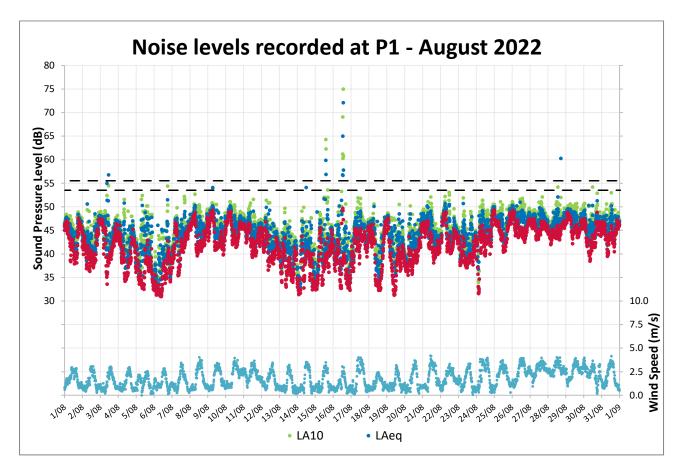


Figure 7: Noise Levels Recorded at P1 for August 2022

Report No: DAT18845

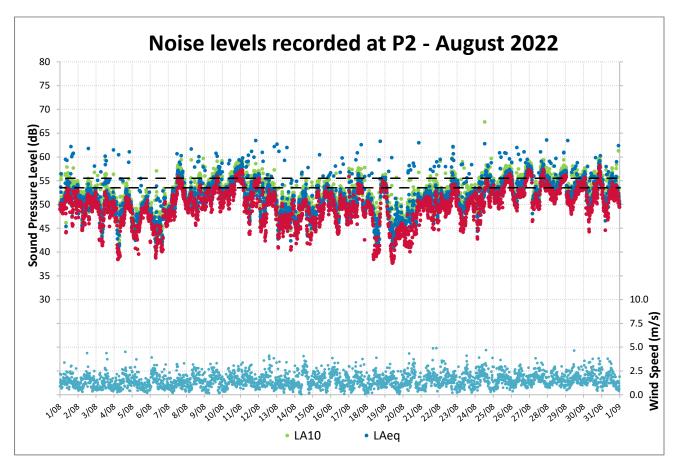


Figure 8: Noise Levels Recorded at P2 for August 2022

Report No: DAT18845

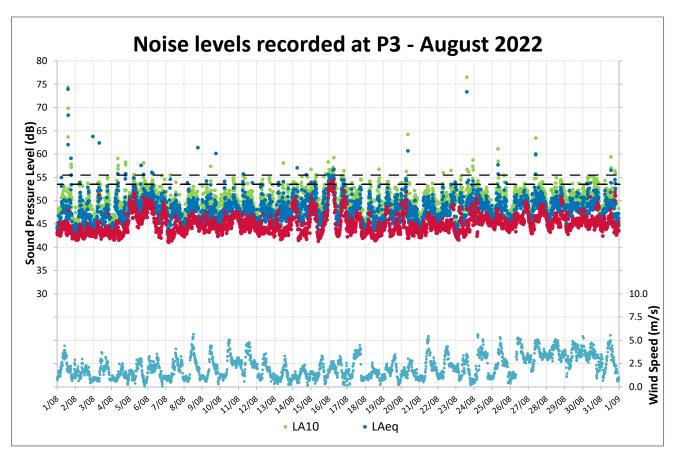


Figure 9: Noise Levels Recorded at P3 for August 2022

Report No: DAT18845


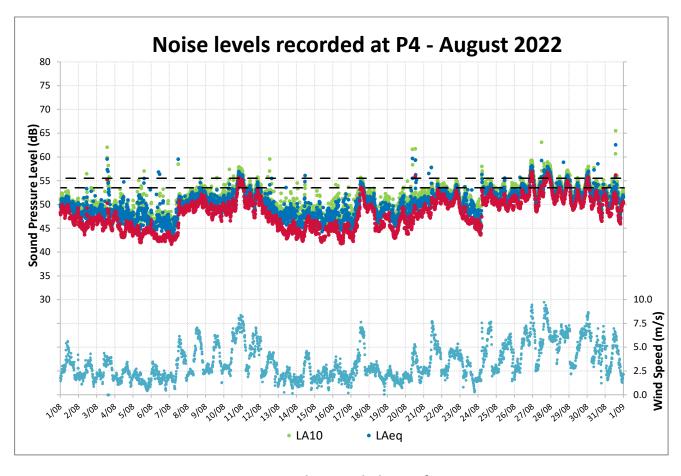


Figure 10: Noise Levels Recorded at P4 for August 2022

Report No: DAT18845

Port of Hay Point



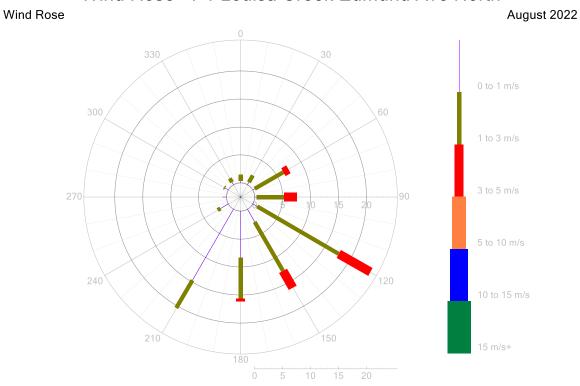


100.0% valid data present

Figure 11: P1 Wind Rose 5-Minute Data for August 2022

Report No: DAT18845

Port of Hay Point

Wind Rose - P2 Louisa Creek Edmund Ave South

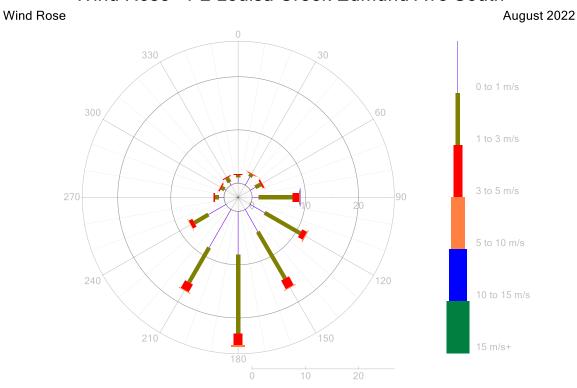

100.0% valid data present

Figure 12: P2 Wind Rose 5-Minute Data for August 2022

Report No: DAT18845

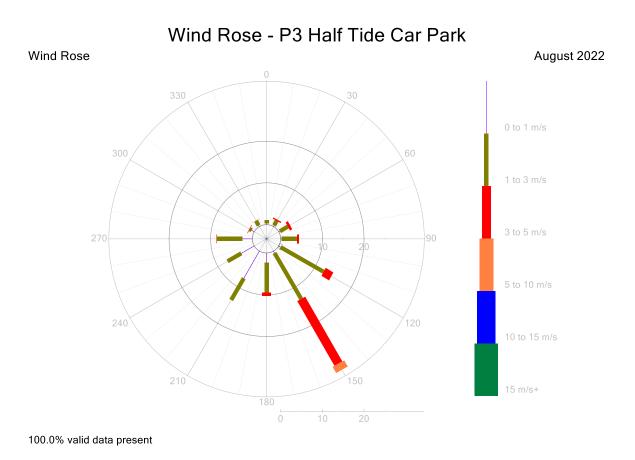


Figure 13: P3 Wind Rose 5-Minute Data for August 2022

Report No: DAT18845

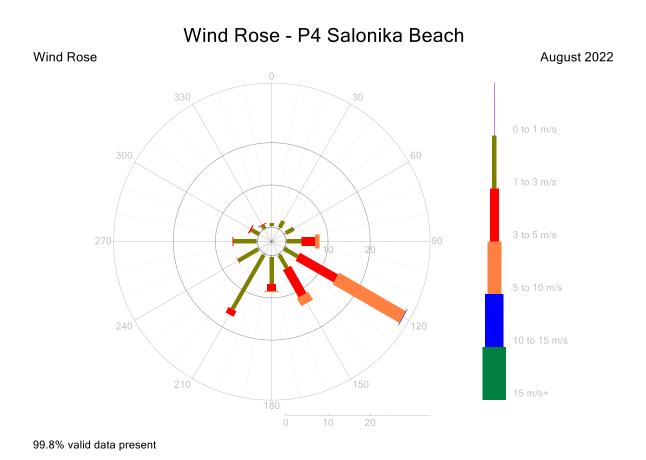


Figure 14: P4 Wind Rose 5-Minute Data for August 2022

Report No: DAT18845

Port of Hay Point

Ambient Temperature 5-Minute Averages - P3 Half Tide Car Park August 2022

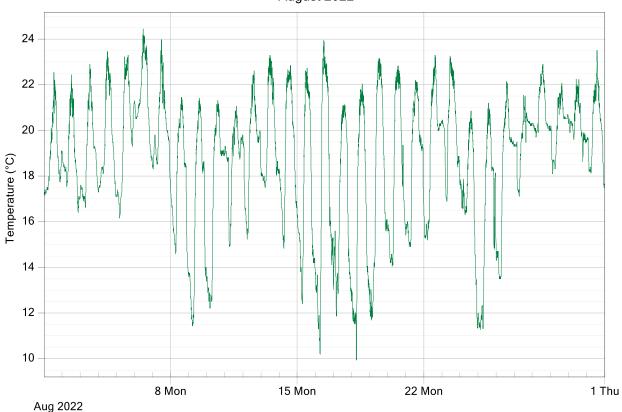


Figure 15: Port of Hay Point AT 5-Minute Averages Data for August 2022

Report No: DAT18845

Port of Hay Point

Relative Humidity 5-Minute Averages - P3 Half Tide Car Park August 2022

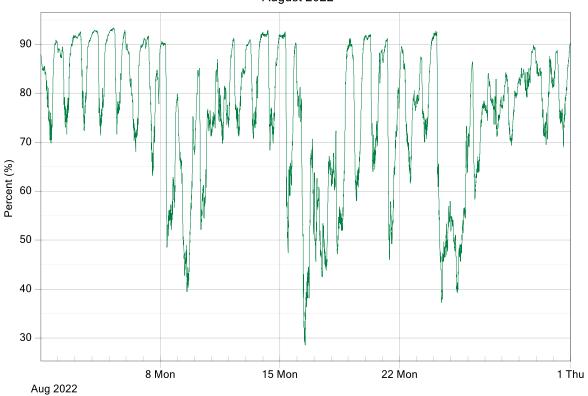


Figure 16: Port of Hay Point RH 5-Minute Averages Data for August 2022

Report No: DAT18845

Port of Hay Point

Rain - Daily Totals

August 2022 100 90 80 70 60 Rainfall (mm) 50 40 30 20 10 8 Mon 15 Mon 22 Mon 1 Thu Aug 2022

Figure 17: Port of Hay Point Rain Daily Totals for August 2022

------ END OF REPORT -----

Report No: DAT18845

Port of Hay Point

Appendix 1 - Definitions & Abbreviations

°C Degrees Celsius

μg/m³ Micrograms per cubic meter at standard temperature and pressure (0°C and 101.3

kPa)

AT Ambient Temperature

atm Atmosphere

calm Wind conditions where the wind speed is below the operating range of the wind

sensor

dBa A-weighted decibels

deg Degrees (True North)

m/s Meters per second

mg/m² Milligrams per square meter

PM₁₀ Particulate less than 10 microns in equivalent aerodynamic diameter

RH Relative Humidity

TSP Total suspended particulates

WD Vector Wind Direction

WS Vector Wind Speed